COMMONWEALTH OF KENTUCKY

BEFORE THE PUBLIC SERVICE COMMISSION

In the Matter of:

COOPERATIVE CORPORATION, INC.)
) CASE NO. 98-593
ALLEGED FAILURE PURSUANT TO 807 KAR 5:041, SECTION 3, TO COMPLY WITH NATIONAL ELECTRIC SAFETY CODE, 1990 EDITION, SECTION 42, RULE 420 H; RULE 421 A; RULE 422 A; AND, SECTION 43, RULE 431)))))

ORDER

Foothills Rural Telephone Cooperative Corporation, Inc. ("Foothills RTCC") is a Kentucky corporation which engages in the transmission or conveyance over wire, in air or otherwise, of any message by telephone or telegraph for the public for compensation and is a utility subject to the Commission's jurisdiction. KRS 278.010(3)(e) and KRS 278.516(2).

KRS 278.280(2) directs that the Commission is to prescribe rules and regulations for the performance of services by utilities. Pursuant to this statutory directive, the Commission promulgated Administrative Regulation 807 KAR 5:041, Section 3, which requires telephone utilities to maintain their plant and facilities in accordance with the standards of the National Electric Safety Code ("NESC").

Commission Staff submitted to the Commission a Utility Accident Investigation Report dated August 6, 1998, attached hereto, which alleges that:

- 1. Big Sandy Rural Electric Cooperative Corporation ("Big Sandy") maintained a single-phase distribution line carrying 7,620 V on Patterson Creek at Flat Gap, Johnson County, Kentucky. Big Sandy's line was built over (over-built) a telephone communication line constructed and maintained by Foothills RTCC. Each system co-existed within the same easement space with the Big Sandy line simply being higher than the other.
- 2. On May 20, 1998, Foothills RTCC was in the process of replacing one of its old communication poles with a new 25 foot pole. The old pole and the hole for the new pole were located between two Big Sandy poles to which was attached the single-phase distribution line.
- 3. Four (4) employees of United, Inc., Dewey Lemaster, Donald McCoy, Anthony McDowell, and Paul Hale acting on behalf of Foothills RTCC, were working to set the new 25-foot communication pole adjacent to the old pole. Lemaster was the foreman in charge of the work crew and McCoy and McDowell were physically attempting to set the new pole by pushing and maneuvering it into the hole which had been prepared.
- 4. The crew was using a block and tackle rigging and Lemaster was operating a digger derrick truck's wench line. The block and tackle was attached to the old pole of Foothills RTCC and was attached to two (2) of Big Sandy's distribution poles.
- 5. In pushing and maneuvering the new pole, McCoy and McDowell caused the top of the pole to contact the energized primary conductor and the neutral conductor of Big Sandy's energized line facilities. The new pole was scarred with a burn mark 56 2/3 inches from the top.

- 6. McCoy and McDowell each received a shock. McCoy was transported to the local hospital but McDowell did not seek medical attention.
- 7. NESC, Section 42, Rule 420 H, mandates that employees shall use personal protective equipment and Rule 422 A specifically addresses employees who are setting, moving, or removing poles in or near energized electric supply lines. 422 A mandates that employees "shall wear suitable insulating gloves or use other suitable means" Neither Donald McCoy nor Anthony McDowell were wearing rubber gloves and sleeves, which violates NESC, Section 42, Rule 420 H and Rule 422 A.
- 8. Dewey Lemaster was the foreman in charge of the work crew when the accident occurred and he was operating the truck wench in an attempt to set the new communication pole. NESC, Section 42, Rule 421 A provides that the person in charge shall see that safety rules and operating precautions are followed by persons under his direction. By failing to direct McCoy and McDowell to wear protective equipment and to use safe procedures as hereinabove set out, Lemaster violated NESC, Section 42, Rule 421 A.
- 9. NESC, Section 43, Rule 431 provides minimum distances which employees shall observe when they take any conductive object (new pole) near exposed energized facilities (Big Sandy's 7,620 V distribution line). McCoy, McDowell, and Lemaster violated NESC Section 43, Rule 431 because the new pole contacted the distribution line of Big Sandy.
- 10. Commission Staff measured all clearances of the energized distribution line of Big Sandy and determined that the energized facilities met or exceeded allowable NESC distances. Big Sandy was not in violation.

The Commission, based upon the facts contained in the Utility Accident Investigation Report, finds sufficient evidence to believe that Foothills RTCC has failed to comply with 807 KAR 5:041, Section 3; NESC, Section 42, Rules 420 H, 421 A, and 422 A and Section 43, Rule 431.

The Commission, on its own motion, HEREBY ORDERS that:

- 1. Foothills RTCC shall submit to the Commission within 20 days of the date of this Order a written response to the allegations contained in the Utility Accident Investigation Report.
- 2. Foothills RTCC shall appear on the 14th day of January, 1999 at 10:00 a.m., Eastern Standard Time, in Hearing Room 1 of the Commission's offices at 730 Schenkel Lane, Frankfort, Kentucky for the purposes of presenting evidence regarding the alleged violations of Commission Regulation 807 KAR 5:041, Section 3 and NESC, Section 42, Rule 420 H; Rule 421 A; Rule 422 A; and, Section 43, Rule 431 and of showing cause, if any, why it should not be subject to the penalties prescribed in KRS 278.990(1) for the alleged violations.
- 3. The Utility Accident Investigation Report dated August 6, 1998 is hereby made a part of the record herein.
- 4. Any request for an informal conference with Commission Staff to consider any matter which would expedite the handling or disposition of this proceeding shall be filed with the Commission no later than 20 days from the date of this Order.

Done at Frankfort, Kentucky, this 24th day of November, 1998.

PUBLIC SERVICE COMMISSION

Chairman

Vice Chairman

Commissioner

 λ TTEQ \uparrow

Executive Director

APPENDIX

AN APPENDIX TO AN ORDER OF THE KENTUCKY PUBLIC SERVICE COMMISSION IN CASE NO. 98-593 DATED NOVEMBER 24, 1998

UTILITY ACCIDENT INVESTIGATION REPORT

	INVESTIGATION REPO	PRT
Utility:	Big Sandy RECC ("Big Sandy")	Foothills Telephone Company ("Foothills")
Reported By:	Bruce A. Davis, Jr.	Paul Preston
Dates & Times Accident Occurred:	05/20/98 – Between 11:30 a.m. & 11:	45 a.m.
Utility Notified:	05/20/98 – 12:20 p.m.	05/20/98 – 11:45 p.m.
PSC Notified:	05/20/98 – 12:32 p.m.	05/20/98 — 1:50 p.m.
Investigated:	05/21/98	
Written Report Rcvd:	05/20/98	05/21/98
Location of Accident:	The accident occurred on Patterson C Johnson County.	Creek at Flat Gap, Kentucky in
Description of Accident:	United, Inc. employees were in the pro- Mr. McCoy was injured. The crew- attached to Foothills' old pole to pull attached to the old pole and was also a either side of it. Mr. Lemaster, Forei truck's winch line, which was attached time of the accident. Mr. Lemaster s setting the new pole, Big Sandy's pole time the new pole contacted Big Sand McDowell were trying to push the new energized line facilities. Mr. McCoy and Mr. Hale was standing near by but transported to the hospital. Mr. McDow Lemaster was the foreman in charge and Mr. McDowell were not wearing a	Anthony McDowell, and Paul Hale, all ocess of setting a new pole in line when was using a block and tackle rigging in the new pole. Foothills' cable was attached to two of Big Sandy's poles on man, was operating the digger derrick d to the block and tackle rigging at the said he believed that in the process of es were pulled closer together, at which ly's energized line. Mr. McCoy and Mr. pole into the hole when it contacted the line of the hole when it contacted the line of the accident. Mr. McCoy was well did not seek medical attention. Mr. at the time of the accident. Mr. McCoy protective equipment at the time of the attractor for Foothills at the time of the

Victims:													
Name:	Donald D. McCoy	/	Fatal:	No	Age:	29							
Addr./Empl.:	Rt. 4, Box 12232 310, French Lick,	, Louisa, Kentucky/ Indiana	United, Inc	., 307 Ma	ain St., P () Box							
Injuries:	Shock												
Witnesses:	Name		Address/	Employm	ent								
	Howard Dewey L	emaster	1 1	x 650, Lo nc. emplo	uisa, Keni yee	tucky							
	Anthony McDowe	ell	1	ox 330, E nc. emplo	Blain, Kent yee	tucky							
	Paul Hale		Unknown	/United,	lnc. emplo	yee							
	Name		Address/	Employm	ent								
	Arlie O. Daniel		·		employee								
	Dan Hitchcock		Big Sandy RECC employee										
	Paul Preston (Ge	neral Manager)	Foothills Rural Telephone employee										
	Lonnie Kelly		Foothills Rural Telephone employee										
	Jim Patton		Foothills Rural Telephone employee										
	Donald L. Renner	r (Owner)	United, Ir	nc. emplo	yee								
	Dewey Lemaster	(Foreman)	United, Ir	nc. emplo	yee								
	Jeff McDowell		United, Ir	nc. emplo	yee	······································							
Sources of	Anthony McDowe	l	United, Ir	nc. emplo	yee								
Information:	Paul Hale		United, Ir	nc. emplo	yee								
Probable Violations KAR 5:061, Section 3:	for Employees. I McCoy, and Mr. A electric supply lin (Rubber Gloves a	Safety Code (NESC) Rule 420H and 425 Anthony McDowell vies and were not viend Sleeves). Rule when the acciden	2A. Mr. D were settin wearing pe e 421A. W	ewey Le g a new p rsonal pr lr. Dewey	master, M pole near of otective e	r. Donald energized equipment							
Line Clearances At Point of Accident:	Measured	Minimum Allowed by NESC	Applicabl Editi 199	ion¹	Volt.	Constr. Date							
Phase Conductor to Ground Elevation:	25' – 2 "	14' – 6"	Table 2	232-1	7620V	1994							

Current edition adopted by the Commission. If clearances are not in compliance with the current edition, then the edition in effect when the facilities were last constructed or modified would apply.

Neutral Conductor to Ground Elevation:	21' – 6"	9' 6"	Table 232-1	N/A	1994
Comm. Conductor to Ground Elevation:	14' – 6"	9' 5"	Table 232-1	N/A	1966
Phase Conductor to Foothills Pole:	9' – 3"	8' — 0"	Table 241-1	7620V ⁻	1994
Neutral Conductor to Foothills Pole:	5' - 7"	3' – 0"	Table 234-1	N/A	1994
Phase Conductor to Foothills Cable:	10' – 6"	6' – 0"	Table 233-1	7620V	1994
Neutral Conductor to Foothills Cable:	7' – 0"	2' – 0"	Table 233-1	N/A	1994
Date of Measurement:	05/21/98				
Approximate Temp.:	83°F				
Measurements Made By:	John W. Land and	l Vern Miracle, PS0	Engineering Staff		
Investigated By:	John W. Land and	l Vern Miracle, PSC	Engineering Staff		
Signed:	Johnwa	Land	1 7	mai	l

Attachments A. Big Sandy RECC's Accident Report
B. Foothills Rural Telephone's Accident Report
C. Photographs of Accident Site

Attachment A	
Big Sandy RECC's Accident Report	

Accident Investigation Report
Big Sandy RECC/Foothills Rural Telephone
Mr. Donald D. McCoy



504 11th Street Paintsville, Kentucky 41240-1422 (606) 789-4095 • Fax (606) 789-5454

5/22/98

Mr John Land Kentucky Public Service Commission P.O. Box 615 Frankfort, KY 40602

Dear Mr. Land:

Branch Office:

Box 8, Glyn View Plaza Prestonsburg, KY 41653 (606) 886-2987

RECEIVED

MAY 26 1998

DIVISION OF UTILITY ENGINEERING & SERVICES

Around 11:30 a.m. on Wednesday, May 20 1998, a contractor for Foothills Rural Telephone was setting a 25' telephone pole off an old telephone pole in mid-span between Big Sandy RECC's poles. The pole came in contact with the phase and neutral. From top of pole down to the burn mark measured 56 3/4". No other burn marks were found. Vines in a tree next to where they were setting the pole may have got tangled around the pole as it was being set. This happened on Patterson Creek at Flat Gap, Kentucky in Johnson County.

Measurements from: Phase to ground......25' Neutral to ground......21' 5" Contractors name: United.......Name of person shocked: Donald McCoy

We were notified by Foothills Rural Telephone about the electrical contact at 12:20 p.m. Arlie Daniel and myself went to the accident site to investigate. Bruce Davis Jr., General Manager for Big Sandy RECC called Foothills Telephone back around 12:25 p.m. and then reported the accident to the Public Service Commission about 12:35 p.m. I talked with you at 2:20 p.m. and gave an update on the situation.

Diagram of accident site and pictures are enclosed. Also I have enclosed the staking sheet for that particular area and a copy of our annual meter reading report for that area. As you can see by the date on the report, the last time was 9/25/97.

If you need any further information, please contact Arlie Daniel or myself.

Sincerely.

Dan Hitchcock

Member Service Department

Enclosures

n. firty

15410 1-5 16C71

SEP 17. 19

BIG SANDY RECC ANNUAL METER READING REPORT UBEEMTRS - 01 10/2/47

	ACCOUNT N	O METER NO	CONSUMER NAME	NO OF LIGHTS
		284274	JIMMY R LEMASTER 9-25	- 0 <u>2307</u>
		564276	JOE H ROSEBERRY	0 2014
	-	900051273	ROBERT CURTIS 9-25	1V <u>5635</u>
		371288	GEORGE THACKER 9-25	1 350
		900320284	DAN'BARKER 9-23	0 09/5
	-	100052	TERESA ESTEP 9-25	0 4004
(*		-432286	PAUL BRIAN CANTRELL	0
		900447284	KRISTIE DAVIS 9-25	0 1694
		184294	SANDRA ESTEP 9-25-	91 1 <u>393/</u>
		122294	MICHAEL ESTEP 9-25	0 54461
		900274286	JAMES A SALYERS 9-23	0 6960
		900114286	GEORGE THACKER 9-25	1- 086.
		506275	KERRY L ROBERTS 9-24	0 0170=
		900123281	RICK CALDWELL 9-24	1 0602
		190297	HOMER CANTRELL 9-24	o <u>0003</u> .
		900043584	ROBERT STURGILL 9-25	V. 1/4.5 1004
		276272	LOUISE LEMASTER 9:22	M 2 0264:
		900145277	MALTA SALYER (Metch in	side of decused, No 16h
		384295	CLINT SALYER JR 9-22	0 2964
1				
		367 <i>2</i> 95	JOHN O BOLTON 9-24	o <u>/2/9</u>
		421287	CHARLES BOWLES 9-25	2400 <u>2973</u>
		46287	BETHEL CHURCH . 9-25	1/ 12251
		900191284	DENVER SALVER 7-25	1 2 <u>9997</u>

900231288 WILLARD C RAMEY 9-25


397295

TOMMY STANIFORD 9-25-

Neutral

Pole or Gaund 563/4" 10" al'5"

6452 9528 RIG SANDY RURAL ELECTRIC Staking Sheet CONST. WORK ORDER NO. COOPERATIVE CORPURATION RET. WORK GROER NO. . PAINTSVILLE, KENTUCKY SYSTEM DESIGNATION: KY. 58 FLOYD Work Plan Reference ... 41240 SHEET NUMBER 3 T C 3 PRI. BACK SPAN SERVICE WIRE SIZE POLES H & C PRI. UNIT TRANS. M ANGLE LEAD ANCHOR REMARKS MISC. U. B. WIRE SEC. WIRE SPAN WIRE N 1 K 1 N 1 K 1 N N I 100 X 1 270 40 17 28 7 17-1-229 111-Forted in Trans. Card By pro-1++ ---111 EXISTING UNITS TO REMAIN N - NEW UNITS I - ROMOVAL UNITS Este T3~~1-ADDRESS
LOCATION / STAKED BY DAT DATE . PRINT BY MAT'L CHECKED BY DATE ISSUED: DATE T1-66.52 4-78-7 DATE CONP. X REMARKS: .. C-+ 7 7 11 NEW SERVICE
RET. SERVICE
REC. ONLY
FOLE: ADD. REMOVE.
CHANGE
VARD LIGHT
VARD LIGHT
VARD LIGHT
POLEM RESERVE.
POLEM RESERVE.
REC.
TRANS.
TRANS. (Foothills Telephone) Tailgate Discussion Held m1-66.60 13 ne. 2

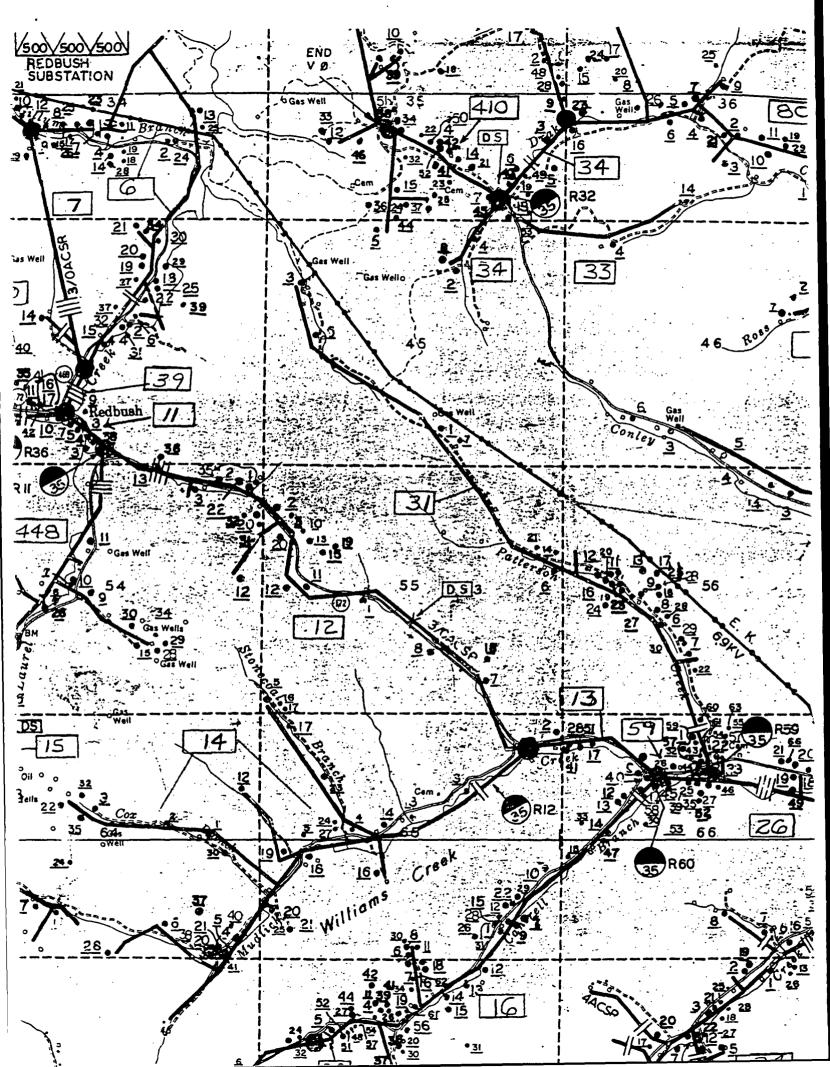

5/21/98

5/20/98

Mr John Land Kentucky Public Service Commission P.O. Box 615 Frankfort, KY 40602

Dear Mr. Land:

A contractor for Foothills Rural Telephone was setting a 25' telephone pole off an old telephone pole in mid-span between Big Sandy RECC's poles. The pole came in contact with the phase and neutral. From top of pole down to the burn mark measured 56 3/4". No other burn marks were found. Vines in a tree next to where they were setting the pole may have got tangled around the pole as it was being set. This happened on Patterson Creek at Flat Gap, Kentucky in Johnson County.

Diagram of accident site and pictures are enclosed. If you need any further information, please call me.

Sincerely

Dan Hitchcock

Member Service Department

Enclosures

					•
				Δ ++	achment B
			Foothills Rural	Telephone's Ac	cident Report
•					
		·			
	•		•		
	<u>-</u> ·		•		
				•	
			·		



HILLS RURAL TELEPHONE COOPERATIVE CORPORATION, INC.

FOOTHILLS TEL.

P.O. Box 240 Staffordsville, Kentucky 41256 Telephone Number: 606-297-3501 FAX Number : 606-297-2000

		Date: 5/22/98
•	Following	is/are 17 page(s) including this cover.
		URGENT NORMAL
TO:	COMPANY	<u> </u>
	CONTACT	John Land
	ADDRESS	
	CITY/ST	
	FAX NO.	502-564-1582
****	*****	*****************
FROM	: COMPANY	
	CONTACT	Paul C. Preston
****		*********
		SPECIAL INSTRUCTIONS
_		
_		
_		
_		
-		
-		



FOOTHILLS TEL.

May 22, 1998

Mr. John Land Engineering Branch Public Service Commission 730 Schenkel Lane P.O. Box 615 Frankfort, KY 40602

Dear Mr. Land:

Attach you will find Foothills' report of accident that you and Vern Miracle investigated on May 21, 1998.

The pole being changed out was placed into service about 1966. Central Associated Engineers did plant inspection on this line in May 1997 as dated on staking sheets.

If I or Lonnie Kelly can be of further help, please call.

Sincerely,

FOOTHILLS RURAL TELEPHONE COOPERATIVE CORPORATION, INC.

Paul E. Preston General Manager

PEP/syw

Enclosures

cc: Don Renner United, Inc. DATE of Accident = 5/20/1998 Exchange = Flat Gap TIMO Aprix = 11:30 TO 11:45 Rocete A20-95 Time Footbells notified by Dewey Lunster on Two-way Per- April 11:95 Time Factiles (charles Guble) colled 911 = 11:48 TIME LIK Approclase Score = 12:10 Time I Red out to working By SANNY Rock 12:15 Aubulares TRANSported. DONALD Milloy TO Paul B. Hall Regional Medical CENTUR Antlony Mc Dowell Stayed of Job Sitis

Indoviduels that were shocked (1) Donald NSCoy @ Anthony Mc Dowell

LI L Donald NSCoy & Anthony Mc Dowell United Employees that were at some of redut Dewby Lenston softeny Mc Dowell Paul Horle . Doutld McCoy.

Footbells employees ARRIVED AFFER Accident Louvie Kelly Jim Patton

By SANCY Reac Employeess 1. SERVICE MAN ? 2. ARlia DAMES 3. DAN Hitchcock

Some one with Big Sandy Kecc Word PSC Paul Preston Called Wayne Bres PSC

At site on 5/21/98 10:00 AM. John LAND VERN Mixocle

... Adie Daniels By Sandy Rece Dan H. tobook By Sundy Rece

... Paul Prostou Foothells Footbells ... Lawie Kelly Jim Patton Foothills

2606 297 2000

United DON RENNER

... Deway LEMISTER Unifol JEFF Mi Dowell united . Anthony McDowoll Shu: tool Paul HAle United


AN Accident occurred on wednesday May 20th 1998 in Flat Gop exchange ON PATORSON CEOCK (A20-PS). DEWEY Reported by Too-way company Rolio TO Chaplant betwoon 11:30 and 11:45 AM. CHARLONA CALLS 91/ AND Reported AN sociont occurace When I serioud on the scane emorgancy puising work Alexaly on site. They were ing Donald Milay lor subuleum Transport To Paul B. Hall Regional Word Lanton. HE was softing up on Bad side. - Dewoy said They ware pulling pole up - U.A Repes and Pully with which on Degree He said He saw thou Fall but He though Thoy got tappled up in vivos on grown de didn't how they were Stucket Paul said He Look over at thom as They work moving pole up in ATR withthe But of - The pla Mexice the hale that was day then He Looked severed again and Authory E DONAL WERE LAYING on ground soveral food BACK FROM the boss of pole. Ho SAIN DONALI WAS JORKING And TURNOR white Looking 1 They Sted Devolds tyes was med with Weto: up and joskery Anthony was

-

Morning that Donald wouldn't sweller his tang: ... They said Flowald was unrensus fice a few .. minetos. While the was happosing Anthon, ... Put his Lingua in Donald's palm and ... ASK HIM I HE could hope then to Squares His Erigen, Donald Rosponded with a SOUTHSE TO KIS Fingurs.

A20-P5

Flat Gap

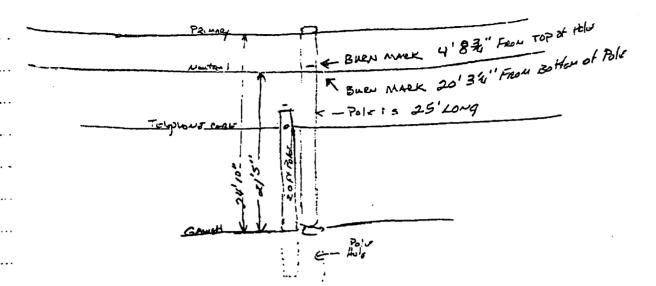


PRIMARY ->

NEUTENL ->0 - ENEN MARK

Down El Ms Cay


E PAU HALL WAS SOMEWHILL-AROUR RIGHT SON OF POLE-

- 1. Dewey Lungston was oppositing Truck
- 2. Donald Mccoy, Anthony MEDOWN & Paul Haie worker AROUND pole.

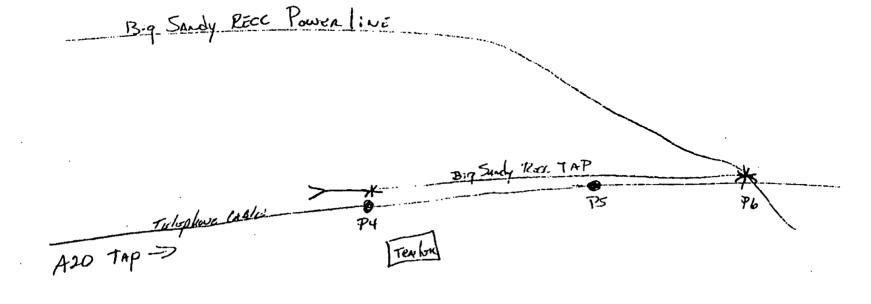

Foothills was OVER Built by Big SANDY ROCK FROM
P6 TO P4 OF A20 TAP TO SCHOOL POWER
TO A TRA-lone At P4.

C	ONSOL	IDATE	D DES	IGN	311	REO BY:	D.CM			MST, REL			≌	DATE	87	}		SCRIPTION	COMPANY: F	COTATIE	<u>-7</u>	
•	CONS	ULTAN	TS. IN	C.	DA	16.	4.79	(6-75)) AS	IIGN.					 	╅╾╼			ENCHANGE: F		;·	
		ISTON, KI			20	A SECURE	D DY:		co	MPL			REVISIONS		1				LINE AZ	۵		
	FEET	MION, M	DETUCKY		DA	TE:			AS	BUILT					1				sheet 2	OF	9	
		Ç	le. V	7	290	<u>2</u>		El 25.		- S(co.	\ "	ن د.	5			97-3	spil To Ne	44,				
	_185	5	* France	 72. (me	145 14			P14:	9 - 134 	•		11 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1			ঠ		P39	360.	PIO	with the Pilipe spenished		
													<u>.</u>				āĀ				÷	
						-							3							_		
		Flo	1	3		-							3		1-25-1 IRS AH	18EKS	<u>}_}-}-1</u>	CIZ-ZIP(W)				
our l								·				<u></u>		□ [™]	K A		_H:_					
OLE PEO.	POLE H-C	FL- YEAR PLACED	12		- GQY PC	AMC.	YERM- LD COIL	MISC PN	ENCL.	SPLICE	PED.	TERM-LD COIL		□ [™]	K A		_H:_	CIZ-ZIP(W)	(1388.)		ATION	
MO.		YEAR		"A" R3-3			YERM- LD COIL PG	MISC PN	<u>. </u>	SPLICE Y HC	PED. SU	TERM. LD COIL BG	TRENCH BM70	□ [™]	K A	W. Care C.	_H:_	CIZ-781P(64) CIB-74.P(E)		7A9UI QUAN.	ATION	
MO.	2012 32.13	YEAR	12	"A" R3-3		4#5 (1-3)	PE	MISC PH	(RI)	SPLICE 4 HC	PEO.	TERM- LD COIL BG		□ [™]	1. V 0x (e)		_H:_	CIZ-781P(64) CIB-74.P(E)	(1388.)			
MO.	(Fig.	YEAR	12	"8" R3-9	(1-2)	(1-3)	9-6	MISC PW	<u>. </u>	SPLICE v HC	PTD.	TERM-LD COIL		□ [™]	K A	* e ^q ;) (180°)	M: 4:	CIZ-781P(64) CIB-74.P(E)	(1388.)			
MO. V		YEAR	12	"8" R3-9		(1-3)	PE	MISC PN	(RI)	SPLICE / INC	PED.	TERM-LD COIL		□ [™]	1. V 0x (e)	* e ^q ;) (180°)	_H:_	CIZ-781P(64) CIB-74.P(E)	(1388.)			
MO. V L Y	(Fig.	YEAR	12	"8" R3-9	(1-2)	(1-3)	9-6	MISC PN	(RI)	SPUCE 7 INC	PED.	TERM. LD COIL BG		□ [™]	1. V 0x (e)	(180')	M: 4:	CIZ - WIP(WY) CIB. 24.P(E) NOTES	(1388.)			
MO. V -1 -1 -1	(#) (#)	YEAR	12	"8" R3-9	(1-2) (1-2)	(13)	9-6	MISC PN	(RI)	SPLICE 7 INC	PED.	TERM-LD COIL BG		□ [™]	or (e)	* e ^q ;) (180°)	M: 4:	CIZ-781P(64) CIB-74.P(E)	(1388.)			
MO. V Y	(#10) (#10)	YEAR	12	"8" R3-3	(1-2) (1-2) 	(1-3)	9-6	MISC PN	(RI) RI	SPLICE V IIC	PEO.	TERM. LD COIL BG		□ [™]	1. V 0x (e)	్రార్ట్స్ (1 <u>90</u>)	M: 4:	CIZ - WIP(WY) CIB. 24.P(E) NOTES	(1388.)			
MO. V -1 -1 -1 -1 -1 -1 -1 -1 -1 -1	(#) (#)	YEAR	12	"8" R3-3	(1-2) (1-2)	(1-3) 13. (1-3)	9-6	MISC PM	(RI) RI (ei)	SPLICE V HC	PED.	TERM- LD COIL BG		□ [™]	180°	(180')	M: 4:	CIZ - WIP(WY) CIB. 24.P(E) NOTES	(1388.)			9
MO. Y 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	(#10) (#10)	YEAR	12	"8" R3-3	(1-2) (1-2) 	(1-3) 13. (1-3)	9-6	MISC PM	(RI) RI	SPLICE V HC	PED.	TERM- LD COIL BG		□ [™]	or (e)	్రార్ట్స్ (1 <u>90</u>)	H: V: V: Orice Orice	CIZ - WIP(WY) CIB. 24.P(E) NOTES	(1388.)			
1 Y Y Y Y		YEAR	12	"8" R3-3	(1-2) (1-2) 	(1-3) 13. (1-3)	9-6	MISC PM	(RI) RI (ei)	SPLICE Y NC	PEO. SO	TERM- LD COIL BG		□ [™]	180°	్రార్ట్స్ (1 <u>90</u>)	M: 4:	CIZ - WIP(WY) CIB. 24.P(E) NOTES	(1388.)			
1		YEAR	12	"8" R3-3	(1-2) (1-2) 	(1-3) 13. (1-3)	9-6	MISC PM	(RI) RI (ei)	SPLICE Y NC	PEO. SU	TERM- LD COIL BG		□ [™]	180°	(180) (180) (180)	H: Y:	CIZ - BIP(W) CIB - 24.P(E) NOTES	(1388.)			9
1 × 1 × 1 × 1 × 2	\$ 15 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	YEAR	12	"8" R3-3	(1-2) (1-2) 1-2 (1-2)	13.	9-6	MISC PM	(RI) RI (ei)	SPUCE Y HC	P\$0.	TERM- LD COIL BG		□ [™]	180° 290° 240°	్రార్ట్స్ (1 <u>90</u>)	H: Y:	CIZ - WIP(WY) CIB. 24.P(E) NOTES	(1388.)			Q
Y		YEAR	12	"8" R3-3	(1-2) (1-2) 	13.	9-6	MISC PM	(RI) RI (ei)	SPUCE Y HC	PED. 80	TERM- LD COIL BG		□ [™]	180°	(180) (180) (180)	H: Y: ,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	CIZ - BIP(W) CIB - 24.P(E) NOTES	(1388.)			0

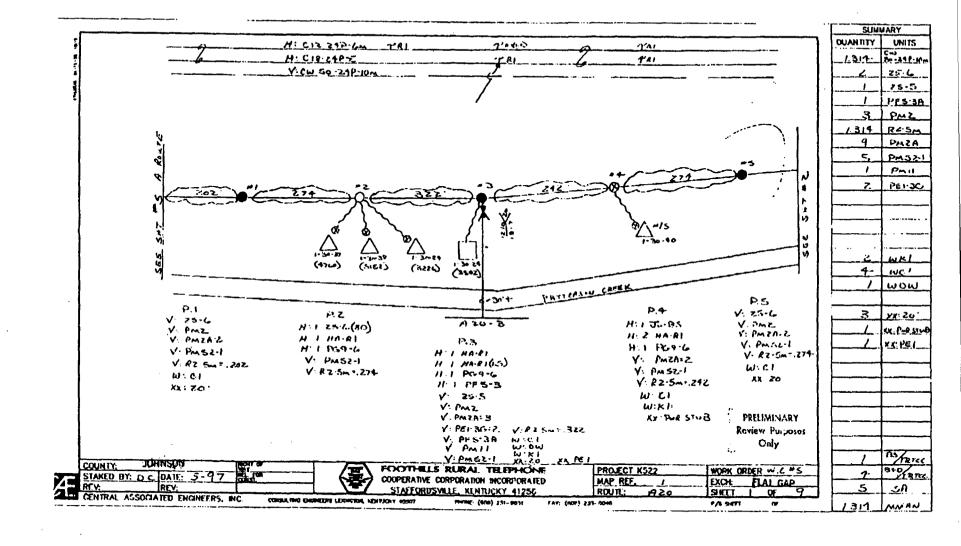


SUMMARY YTHIAUC UNITS 781 N.C12-24 P. GM 121 2'41 2416.13 1376 CW 44.0.13 741 H C 11 247-E V CW 60-24 F- 10~ PE - 30 PERSA PES:3A PMZ 2 PMRA .5 PM 52-1 PMLI AZe-' Payrenes CHEK Fx Pel P.10 P.7 P.C PB H:1 25-6(80) xx: (°)-H: 1 755 (80) H-1 JW-85(+56-37) HI Ju-BS 2.9 V PM 52-1 H: I HA-RI H & HARI H Z PEITE 11.1 25.5 (80) H: 1 P61-2 H: Z PF1-3 W. 1 1207-6 H' Z HARIGES H' 1 PF1-3 H' Z HA-RI HI PAZA H Z PG-4-10 V. Prasz-1 11: 1 Pag-6 PFIBGIZ FMZ V ITI-SA H Z PMZA V. Perias PMZA'Z HI PMI V. PMKZ-1 V. PFI-SA Pm 57.1 4. AMZA Y. PMZA V PMII V. PE1-36-2 V: PM 52-1 V. PMZ XX PET V. AT SEA V. PMZA'S XX: PF V. Pali XX PEI PELLIMINARY M. PF Regiam Purposes BYFULL Cair 116-1 Parce JOHNSON COUNTY: FOOTHELS RURAL TELEPHONE WORK DRDER W.C "S PROJECT K522 STAKED BY: D.C. DATE COOPERATIVE CORPORATION INCORPORATED MAP RET. FLAT GAP EXCH: 30 REY: STAFFORDSVILLE, KENTUCKY 41256 ROUTE: A 20 Ž OF SHEET CENTRAL ASSOCIATED ENGINEERS, INC. PHENE: (408) \$71-9431 FAR (608) 233-0048 r/5 96(1 1376 MMA


						STAKI	NG S	SHEE	T								,					<u> 38-518</u>
V/U GERERATE) BY:			7/	5	EXCH	5	LATO	- 41	^					_		P VIRE	0		Sheet	ho_ 20	or <u>a</u>
MAINTENANCE SERVICE DROCKS JUINT USE PROVIDER GOVERNMENT ACENCU IPLANT UPGRADES	X									F					/-	7	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	Ť	7	ENGINE		Lead
JAJINT USC PROVIDER	3					O ROUT								//	3	Z_{k}		//	//,	Staked 5	44,98	Sy, JP
IPLANT UPGRADES						MERS			£K	<u> </u>		,	/,	ر کر	Z Ç	1/3/		//	//	Checked		
			ZU.	BSCRIB	ER N	AME (1)					,	/,		1	749	"		//		Released for	Const.	
			,	,	γ	MELI	SSA	MEAD	Æ.		/	/5	/9	10	<i>"</i> /	//	///					
SKETCH OF YORK	(DPMI) BS	R/V		BACK	L	POLE	GUY	AHC.	l	GND		Z_{i}	73	/_			/ br	PE .	ra	HA	POLE NO.'S	MISC.
	JU POLE NO.		1 -	SPAN	<u> </u>	LEC	PE.	.bL.	1_	'PN'				/		4	/ 'x.	\perp	•Р•	,2,	'PH25'	MUTES
1 1		Q2-5	P. 5	1274	W.	20 -		 -	12.	2A	A	4			.			_			1	اساتوا
1		274' R2-5	Du.	243	N.	35-6			2A		+		- -		-		w:K				+,	uvcı
1		347.		T	1	711		l			ff	Н	11		-+	+	- K.				1	usc I
1 (R2-5	P. 3	322	Ky:	20 - 30 - G	Xx:1-2	W:1-3	2	2A(3) 11	口		Ш				w:K	ī			1	was con
į į		322.	Λ -	0711	V	30.6	v:1-26	4:1-5/			 - -		-					- -				
1		274	۹.٦.	18 1.X.	W:	25-6			├	••	╁╁			}						-	1 1	1
		R2-5	1.9	202	k.	20-			2.	<u> </u>	11		++	_	_	_		- -			1	luci
· .		202 1			v:	35-6			L			П	Ш									
I M		L	<u> </u>	1		L	L		L		J						<u> </u>	丄				
1 1 1																						
							•															
E																		Ņ.			រី	?:5
1 1-1		6.6				92.5 P.	2			î	2.3						•		•		·	
ا اها ا				- 274	<u></u>	77.3		32	ئد					- 2	47			0				
1 2	25-5	, ,	<u> </u>						คัว.	5	7				SJ.	S				R2-5		
	Į.	ا لسسا		· L		T 24	IED				Ĭ									•		
	L	j				115					1						Ε			1		
1 10	- W- WA					11				, —	1											
\$			-0-			11		<u> </u>		' □	"	وس.	c.						RE	4 K		
	-4	TA	EK?	مد	/	7				H	4					-						
3													-									
											ļ											
L																	· · · · · · · · · · · · · · · · · · ·					

						STAKI	NG S	:HFF	T											- 38-518
V/O GERERATE	'n ov.			•	۔										٠,	. + . e	;			-of_ 2
HAINTEHANCE						EXCII			-					F		VIET	יו			Lead
MAINTENANCE SERVICE URBERS JUINT USE PROVIDE GUVERNMENT AGENC PLANT UFGRADES	1					2 Row								/5/	1.6	<i>37</i> /		SNO	INFER	By JP
PLANT UPGRAIES						ATTERS			EK_			/	/ /	3/4			//	Checked _		
			UZ	BZCKIBE	RN	INNE LIL						//	\$\$		Y /				_	· · · · · · · · · · · · · · · · · · ·
						MELIS	SSA	MEAD	E		/,	4		7	//			Keledzea	for Const.,	
SKETCH OF VORK	AU PELE NEL	R/W	POLE NO.	BACK	L	POLE	GUY	ANC.	GND		/3/	X			//	MAIN		нл	ND.Z	MISC.
	JU PLALE NIL		613	1	 	25-C	PE.	.bl.	"PH"	-6		¥_		$\angle V$	4	,K,	·p.	.2.	'PH52'	Mulks
}	 		Pu			30-7	U:1-26		}	न्ध	714	4	•			-			- L	
								V3.5A		1	<u>tt</u>								1	
			610	374	Y	25.6	.				11	Ш	4_						- 4	المكرا
1			09	272	2	30-6 25-5	A:1.2	OC	2 34	7.	∤ -∤ ·	H	+-			r KIS				wc.2
Ì				<u> </u>	<u>\si</u>	30-6	J:1.76				<u>tl</u>	1 †	-	-	1	KI.	t			
		R2-5	68	264	и:	J.U.	1: 12	H: Pr	31		П	144	1						レ	
	}	2044'	2.7	288	100	25.5	W'1-7C-	VILEA	2, 2437		₩	H	+						1	
		8.5 78'	6.6	ing	M:	30.	Sel:0	rv-1-3	2A	<u>''</u>	什	HH	-		-		1			
PATTE	R1.5	5.7	264 83-5		8	167	313		7.9				P		<u>34</u>	<u>REEN</u>		! ?u	202	P.12 Dogs House

WORK PLAN HULLREACE		KIN																n is 9 / 46
NEW CONSTRUCTION SYSTEM IMPROVEMENT REPLACEMENT RETIREMENT-NO REPLACEMENT NO. UF SERVICES	LOCATION	ALD ALD	\$75 \$1	SIC.	SIGNAT	ION .		· 6.	<u> </u>	· · ·	/so		WIII	(3)/		Line ENG Stake	91.0. NEER 2.2.4	9 DA2
DOM 1 7 CATCUA - MENS, NO.4 EBUD TETAK	·	γ				ANC.	Q UT		7000	SOLON /		1	//	0107		Reice 108	sed for (onst
SELECT OF WORK	## #	POLE MD.	BACK	Ĺ) + C			years.	-PM-			17		Wiki	PROT.	3173 	HO.'S	MISC. HOTES
									1		-							
		 		\vdash					+-	-	+-	-			·		 	
		Y	į. ģi	V.	7.4.		Z'2-?		1		-			170				
		<u> </u>							1		11							
		17	17.77	V.	3,4,				+-		- -						 	
		6	<i>x</i> ?	7	76.						\prod		\Box					
				<u> </u>			77:		二	二	#		口					
	<u></u>	15	L	1/4	ر مار ک	<u> </u>	1.30 %	سسا			11	J	Ť.			L	L	Cre.9-29-97 Co
No. of the second secon) /,		;	×		·			
			•61		en en en en	* 7		·		***	•	*	<u> </u>	τ.		(Com	p 9-25-9. Ruger


•	
	Attachment C
	Photographs of Accident Site
-	

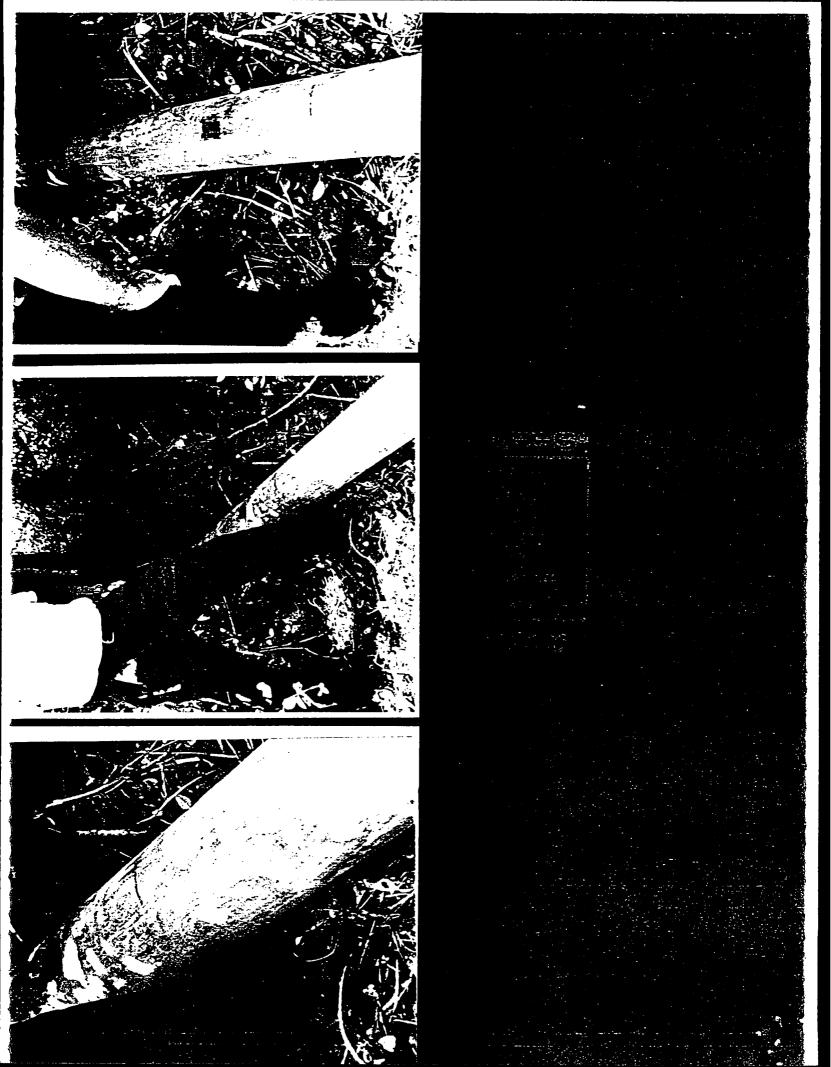


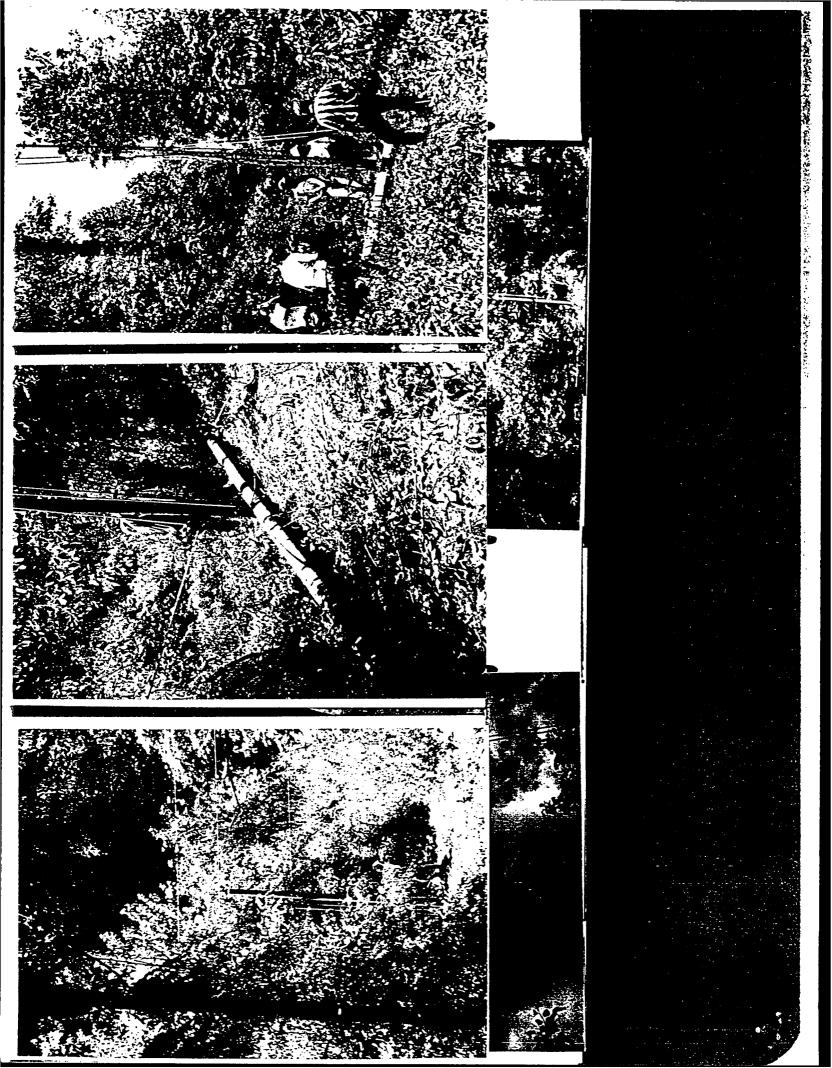






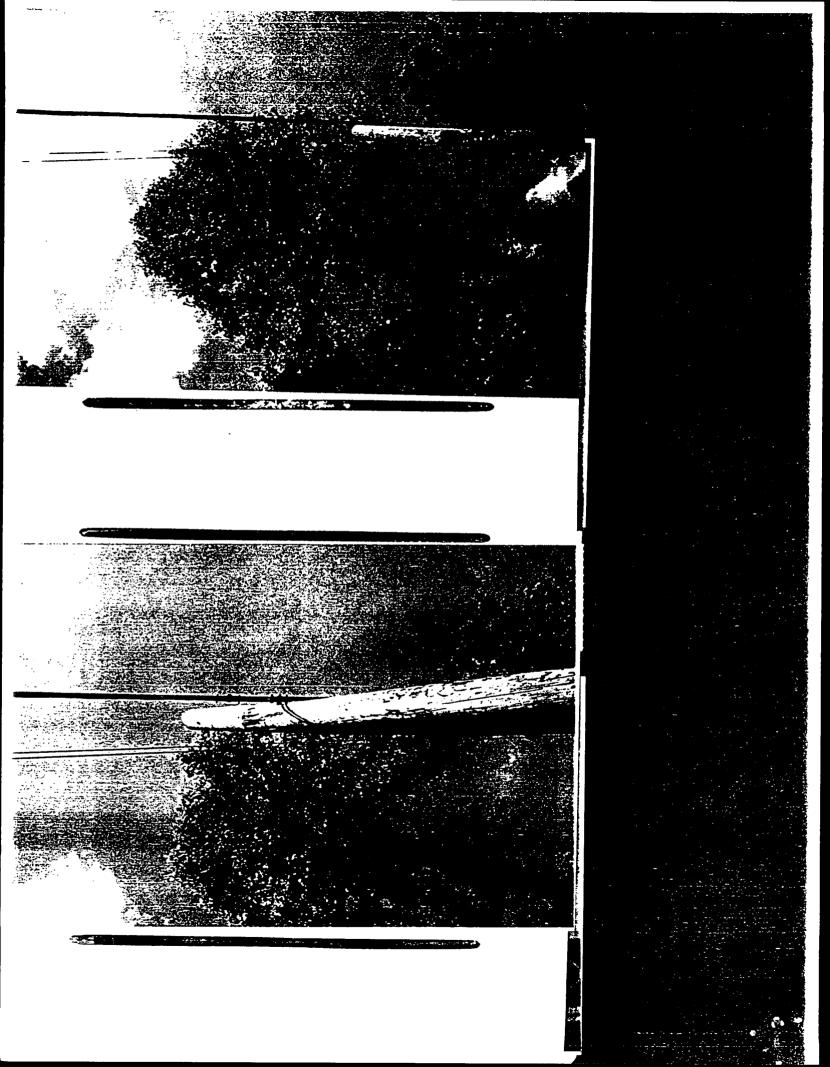


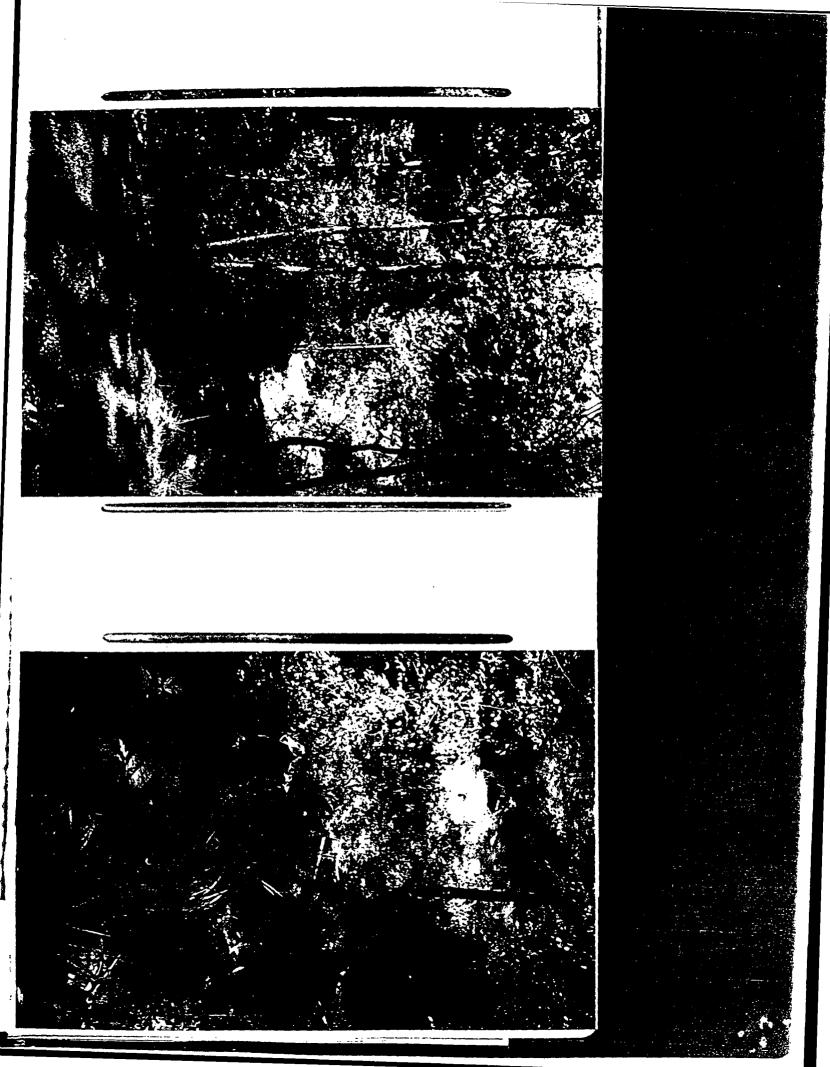


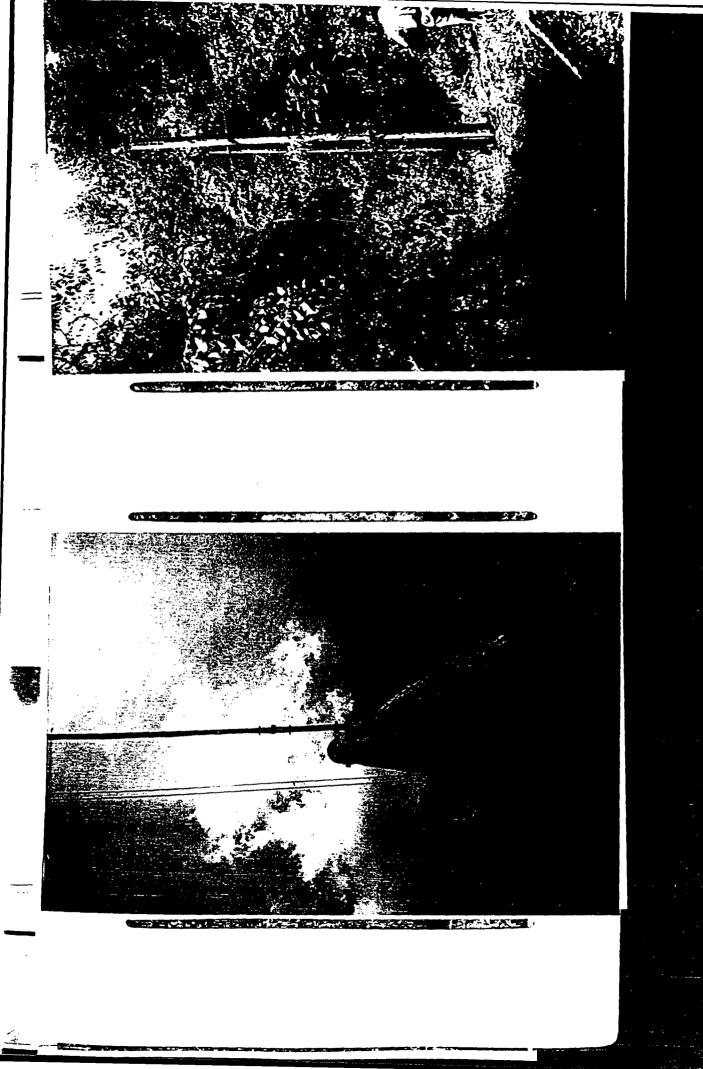



PSC Photos 13:9 Sandy RECC - Foot Hills Rural Telephone

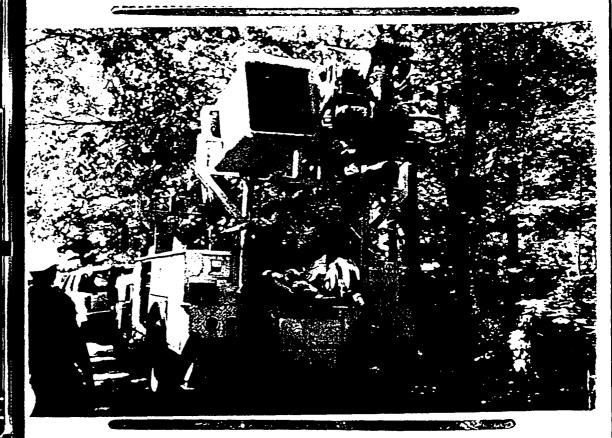

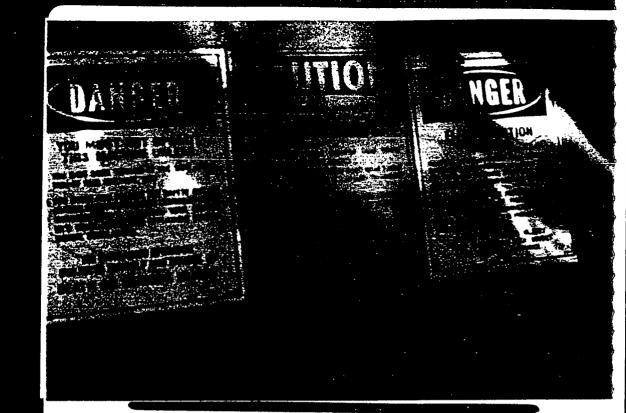



DANGER

ELECTROCUTION MAZATAS KEEP CLEAR MARIA MARIA CLEAR MARIA MAR