Ernie Fletcher Governor

Teresa J. Hill, Secretary Environmental and Public Protection Cabinet

Timothy J. LeDonne Commissioner Department of Public Protection

G. Kelly Nuckols President & Ceo Jackson Purchase Energy Corporation 2900 Irvin Cobb Drive P. O. Box 4030 Paducah, KY 42002-4030



Commonwealth of Kentucky **Public Service Commission** 211 Sower Blvd. P.O. Box 615 Frankfort, Kentucky 40602-0615 Telephone: (502) 564-3940 Fax: (502) 564-3460 psc.ky gov

November 15, 2007

Mark David Goss Chairman

> John W. Clay Vice Chairman

Caroline Pitt Clark Commissioner

RE: Case No. 2007-00456

We enclose one attested copy of the Commission's Order in the above case.

Sincerely,

Beth O'Donnell Executive Director

BOD/tw Enclosure

KentuckyUnbridledSpirit.com



COMMONWEALTH OF KENTUCKY

BEFORE THE PUBLIC SERVICE COMMISSION

In the Matter of:

JACKSON PURCHASE ENERGY CORPORATION

ALLEGED FAILURE TO COMPLY WITH KRS 278.042) CASE NO. 2007-00456

)

)

ORDER

Jackson Purchase Energy Corporation ("Jackson Purchase") is a corporation engaged in the distribution of electricity for compensation for lights, heat, power, and other uses. It is subject to the jurisdiction of the Commission.¹ Pursuant to KRS 278.042, the Commission shall prescribe the service adequacy and safety standards for electric utilities, as stated in the Commission's administrative regulations and in the most recent edition of the National Electrical Safety Code ("NESC"). Under 807 KAR 5:041, Section 3(1), the Commission requires utilities to construct and maintain plants and facilities in accordance with engineering practices set forth in the NESC.

Commission Staff submitted to the Commission an Electric Utility Personal Injury Accident Report ("Report") dated August 28, 2007, attached hereto as Appendix A. The Report alleges that on August 7, 2007, in Marshall County, Kentucky, Joshua Champion was injured at the site of a reconductoring work project.

¹ See KRS 278.010(3)(a).

Jackson Purchase had contracted with Hendrix Electric to conduct a three-phase reconductoring project at Little Cypress Road in Marshall County, Kentucky. Mr. Champion was an employee of Hendrix Electric and was part of the crew that worked on the project.

At the time of the accident, Mr. Champion was installing an armor rod on one of the new three-phase conductors that the Hendrix crew had installed. This newly installed conductor was de-energized and grounded. The three energized phase conductors being replaced had been moved to the fiberglass hot arms, which were attached to the end of the cross-arms. The Report noted that the points of contact were on the clamp of the old energized B-phase conductor moving to the hot arm and the clevis of the block holding the new grounded C-phase conductor. Mr. Champion was working between these two phases while he was installing the armor rod. As he reached to his left while leaning over the hot arm, Mr. Champion made contact with the exposed clamp and clevis holding the two phases. Because adequate protective equipment had not been installed or in use at the time, Mr. Champion sustained burns on his upper torso and neck as well as entrance and exit burns to his chest and back. The four other members of the crew were in close proximity, but did not witness the accident.

The Report noted six probable violations of KRS 278.042. All alleged violations arise under the 2007 edition of the NESC. The alleged violations are as follows:

1. NESC Section 42, Rule 420.C.4, by the employee's failure while working in the vicinity of energized lines to consider all the effects of his actions and to take into

-2-

account his own safety, the safety of other employees, the property of others, and the public in general.

2. NESC Section 42, Rule 420.H, by the employee's failure to use the personal protective equipment, protective devises, and the special tools provided for the work.

3. NESC Section 42, Rule 421.A.2, by the supervisor's failure to see that the safety rules and operating procedures are observed by the employee under the direction of the supervisor.

4. NESC Section 44, Rule 441.A.3.a, by the employee's failure to guard or insulate exposed ground lines, conductors, or other parts in the work area.

5. NESC Section 44, Rule 443.A.1, by the employee's failure to insulate himself from energized parts or failure to isolate or insulate himself from ground and grounded structures when working on energized lines and equipment.

6. NESC Section 44, Rule 443.D, by the employee's failure to avoid working on equipment or lines in any position from which a shock or slip will tend to bring the body toward exposed parts at a potential different than the employee's body – work should generally be done from below, rather than from above.

The Commission, on its own motion, HEREBY ORDERS that:

1. Jackson Purchase shall file with the Commission, within 20 days of the date of this Order, a written response to the allegations contained in the Report.

2. Jackson Purchase shall appear on March 4, 2008 at 10:00 a.m., Eastern Standard Time, in Hearing Room 1 of the Commission's offices at 211 Sower Boulevard, Frankfort, Kentucky to present evidence concerning the incident

Case No. 2007-00456

-3-

that is the subject of the Report. Specifically, Jackson Purchase shall present evidence as to the six alleged violations of KRS 278.042 and the NESC and shall show cause why it should not be subject to the penalties of KRS 278.990 for the alleged violations.

3. The Report, attached hereto as Appendix A, is made a part of the record in this case.

4. Any requests for informal conference with Commission Staff shall be set forth in writing and filed with the Commission within 20 days of the date of this Order.

Done at Frankfort, Kentucky, this 15th day of November, 2007.

By the Commission

ATTEST Executive Director

APPENDIX A

APPENDIX TO AN ORDER OF THE KENTUCKY PUBLIC SERVICE COMMISSION IN CASE NO. 2007-00456 DATED November 15, 2007







n hin

0.

1997 Hodel

Sat File

Coly Eres

PECO Dweit

> abarie servie treas or completifies artikel servery rops or fit within Communes. These are logal documents what defeaded result ar one of clear's negleservised and by to Communic filtenticfy listed ?? El (?) Lower in a 27 manipal getone which her ISC case regular. New bounderhower destail four def Son artificatorizary may, or from boundertexubenticity inpermetismic propose by the upped with Hillen mainest bounderhower when an endower planet was planed around the international propose by the अस्म्बद्धः अत्र स्टूस्ट

Restudy Public Barrise Contribution January 24, 2002



UTILITY:	JACKSON PURCHASE ENERGY COOPERATIVE					
Reported By:	Tracy Bensley					
Accident Occurred:	8/7/2007	Approximately: 12:53 PM CDT				
Utility Notified:	8/7/2007	Approximately: 1:00 PM CDT				
PSC Notified:	8/7/2007	Approximately: 2:00 PM CDT				
PSC Investigated:	8/8/2007	Approximately: 9:30 AM CDT				
Report Received:	August 21, 2007					
Accident Location:	Little Cypress Road, Marshall County, Kentucky					
Accident Description:	August 7 th , 2007 Public Service Commission staff received a call from Jackson Purchase Energy Corporation that a contract crew employee with Hendrix Electric made contact with 7200 volts. The crew was working on a three phase reconductoring job at Little Cypress Road. Joshua Champion (victim) an employee with Hendrix Electric had positioned his aerial truck and began the work tying in the new conductors on this pole. The other 4 crew members at the job site were positioning another aerial truck on the opposite side of the same pole and did not witness the actual contact made by the victim. Joshua Champion was installing an armor rod on one of the new three phase conductors the crew had installed, which was deenergized and grounded. The three old energized phases the crew where replacing had been moved to the fiberglass arms (Hot Arms) which are attached to the end of the crossarms. After the investigation and reviewing the photographs taken by Jackson Purchase employees, the points of contact appears to be on the clamp of the old B phase (which was energized) moved to the hot arm, and the clevis of the block holding the new grounded C phase. It appears that Mr. Champion was working between these two phases, and had reached to his left leaning over the hot arm while installing the armor rod. It appears that Mr. Champion made contact with the exposed clevis holding the grounded conductor and clamp holding the energized conductor. Mr. Champion received burns to his upper torso and neck. While at the accident site and after reviewing the accident report from Jackson Purchase, it appears that adequate protective equipment was not installed at this accident site.					



Kentucky Public Service Commission

Electric Utility Personal Injury Accident Report

VICTIM(S):	NAME		ADDRESS	EMPLOYER	
	Joshua Champion				
	Fatality	Age	Unknown	Hendrix Electric	
	No	26			
	I n j Burns on his upper torso and neck. Entrance and exit burns on his u chest and back. r y				
Witness:	. Name		Address	Employer	
	Tommy Overfield (Heard the Arc)		Unknown	Hendrix Electric	
	Dustin Lanham (Heard the Arc)		Unknown	Hendrix Electric	
	Matt Mattingly (Heard the Arc)		Unknown	Hendrix Electric	
	Jared Champion (Heard the Arc)		Unknown	Hendrix Electric	
Information From:	Na	me	Address	Employer	
	Tracy Bensley		2900 Irvin Cobb Dr. Paducah, KY 42002	Jackson Purchase E. C.	

.....



Temp & Weather:	Sunny, 98°, Heat index between 100 and 105°				
	National Electric Safety Code 2007 Edition				
	Jackson Purchase Accident, 8/7/2007, Possible Violations				
	 <u>420. Personal General Precautions</u> <u>C. Safeguarding Oneself and Others</u> <u>4. Employees who work on or in the vicinity of energized lines shall consider all of the effects of their actions, taking into account their own safety as well as the safety of other employees on the job site, or on some other part of the affected electric system, the property of others, and the public in general.</u> 				
Probable Violations:	<u>420. Personal General Precautions</u> H. Tools and Protective Equipment Employees shall use the personal protective equipment, the protective devices, and the special tools provided for their work. Before starting work, these devices and tools shall be carefully inspected to make sure that they are in good condition.				
	 <u>421. General Operating Routines</u> A. Duties of a First-Level Supervisor or Person in Charge This individual shall: 2. See that the safety rules and operating procedures are observed by the employees under the direction of this individual. 				
	 <u>441. Energized Conductors or Parts</u> Employees shall not approach, or knowingly permit others to approach, any exposed ungrounded part normally energized except as permitted by this rule. A. Minimum Approach Distance to Live Parts 3. Precautions for Approach Voltages from 301 V to 72.5 kV At voltages from 301 V to 72.5 kV, employees shall be protected from phase-to-phase and phase-to-ground differences in voltage. See <u>Table 441-1</u> for the minimum approach distances to live parts. a. When exposed grounded lines, conductors, or parts are in the work area, they shall be guarded or insulated. 				
	 <u>443. Work on Energized Lines and Equipment</u> A. General Requirements 1. When working on energized lines and equipment, one of the following safeguards shall be applied:				
	 <u>443. Work on Energized Lines and Equipment</u> D. Working Position Employees should avoid working on equipment or lines in any position from which a shock or slip will tend to bring the body toward exposed parts at a potential different than the employees body. Work should, therefore, generally be done from below, rather than from above. 				



Investigated By:	Name	Company		
	Jeff Moore	Kentucky Public Service Commission		
Signed:	Juthung Moon		Date	9.20-2007
Reviewed By:	Name	Company		
	John Shupp	Mgr., PSC Engineering Staff		
Signed:	Joh V. Shep	-	Date	9/20/07

Attachments: A. Utility Accident Report on CD

- B. Utility Photographs of Accident Site on CD
- C. PSC Photographs of Accident Site on CD