COMMONWEALTH OF KENTUCKY BEFORE THE PUBLIC SERVICE COMMISSION

In the Matter of:

KENTUCKY POWER COMPANY	
and	
GTE SOUTH INCORPORATED	CASE NO. 89-258
ALLEGED FAILURE TO COMPLY WITH) COMMISSION REGULATIONS	

ORDER TO SHOW CAUSE

Kentucky Power Company ("Kentucky Power"), which engages in the distribution of electricity to the public, for compensation, for light, heat, power, and other uses, is a utility under the jurisdiction of the Commission.

GTE South Incorporated ("GTE"), which engages in the transmission over wire of messages by telephone for the public, for compensation, is a utility under the jurisdiction of the Commission.

KRS 278.280(2) directs the Commission to prescribe rules and regulations for the performance of services by utilities. Pursuant to this statutory directive, the Commission promulgated Commission Regulation 807 KAR 5:041, Section 3, which requires electric utilities to maintain their plants in accordance with the standards of the National Electrical Safety Code (1981 edition),

and Commission Regulation 807 KAR 5:061, Section 2, which requires telephone utilities to do likewise.

Commission Staff has submitted to the Commission an Electrical Utility Accident Investigation Report dated August 23, 1989, attached hereto as Appendix A, which alleges:

- 1. On July 20, 1989, Johnny Minks was fatally injured in Lost Creek, Kentucky, when he came into contact with a 7200 volt single phase overhead line owned and maintained by Kentucky Power. At the time of the incident, Mr. Minks was attempting to install a CB antenna on the roof of a building.
- 2. At the time of the incident, the electric utility lines hanging over the building, the 7200 volt single phase, a neutral conductor, and a lash secondary line, all owned and maintained by Kentucky Power, failed to comply with the minimum vertical clearance standards for above-ground wires and conductors as established by National Electrical Safety Code Rule 234C2. The communications conductor, which hung over the building and was owned and maintained by GTE, also failed to comply with these standards.
- 3. Kentucky Power violated Commission Regulation 807 KAR 5:041, Section 3, by failing to comply with the standards of the National Electrical Safety Code.
- 4. GTE violated Commission Regulation 807 KAR 5:061, Section 2, by failing to comply with the standards of the National Electrical Safety Code.

WHEREFORE, the Commission, on its own motion, HEREBY ORDERS that:

- 1. Kentucky Power and GTE shall each submit to the Commission a written response to the allegations contained in the Electrical Utility Accident Investigation Report within 20 days of the date of this Order.
- 2. Kentucky Power and GTE shall appear on November 15, 1989 at 1:00 p.m., Eastern Standard Time, in Hearing Room No. 1 of the Commission's offices at 730 Schenkel Lane, Frankfort, Kentucky, for the purposes of presenting evidence concerning the incident which is the subject of the Electrical Utility Accident Investigation Report, specifically the alleged violations of Commission Regulations 807 KAR 5:041, Section 3, and 807 KAR 5:061, Section 2, and of showing cause, if any they can, why they should not be subjected to the penalties of KRS 278.990 for their alleged failure to comply with Commission Regulations.
- 3. The Electrical Utility Accident Investigation Report dated August 23, 1989 is hereby made a part of the record of this case.

Done at Frankfort, Kentucky, this 19th day of September, 1989.

Chairman

Vice Chairman

ATTEST:

Executive Director

APPENDIX A APPENDIX TO AN ORDER OF THE KENTUCKY PUBLIC SERVICE COMMISSION IN CASE NO. 89-258 DATED 9/19/89

ELECTRICAL UTILITY ACCIDENT INVESTIGATION

DATE OF THIS REPO	RT <u>8/23/89</u>	SUBMITTED BY John W.	Land
NAME OF UTILITY	Kentucky Power (Haza	rd Division)	
ACCIDENT REPORTED	BY Wayne Edwards-E	Safety and Health Manag	er
DATE & TIME UTILI	TY LEARNED OF ACCIDE	DFT 7/20/895:05 P.M.	
DATE & TIME ACCID	ENT REPORTED 7/20/8	398:50 P.M.	
DATE AND TIME ACC	CIDENT OCCURRED 7/20)/89-4:50 P.M.	
DATE OF ACCIDENT	INVESTIGATION 7/21	/89	
		IVED FROM UTILITY 7/20	
PERSONS ASSISTING	IN THE INVESTIGATION	ON P.R. Williamson Hu	man Resources
Supervisor-R.J.	Eversole Engineer St	upervisor-Glen Combs D	raftsman-
Paul Pratt Servi	ceman-Steve Campbel:	l Serviceman, all pers	onnel of
Kentucky Power.			
NAME OF VICTIM(S)	1. John Minks	SEX N	AGE
PATAL No	NAME OF EMPLOYER:	Self Employed	
INJURIES Sec	cond degree burns to	face; third degree bu	rns to legs.
	2	SEX	AGE
PATAL	NAME OF EMPLOYER:	· · · · · · · · · · · · · · · · · · ·	
injuries			
	3	SEX	AGE
PATAL			
injuries			· · · · · · · · · · · · · · · · · · ·

ELECTRICAL UTILITY ACCIDENT INVESTIGATION (Continued)

LOCATION OF ACCIDENT SITE Mr. Ed. Gregory Heavy Equipment Repair Garage off Hwy. 15 West of Hazard near Lost Creek, Kentucky. DESCRIPTION OF ACCIDENT Mr. Johnny Minks and Mr. Tom Mullins were alleged to have been attempting to install a CB Antenna on a building belonging to Mr. Ed Clemons and leased by Mr. Ed Gregory. Mr. Johnny Minks apparently made accidental contact with a 7,200 volt overhead line, while attempting to install top section of CB Antenna on bottom section which had already been installed on end of this building. SOURCE OF INFORMATION Mr. P.R. Williamson, Mr. R.J. Eversole, Mr. Glen Combs, Mr. Paul Pratt, Mr. Steve Campbell employees of Kentucky Power's Hazard Division. There was also an onsite investigation made by myself John W. Land of the Public Service Commission's Engineering staff, plus utility, coroner and EMT accident reports. I also tried to interview Mr. Tim Mullins but was unable to do so. Hosgital was unable to obtain any information on Mr. Minks. VIOLATIONS OF COMMISSION REGULATIONS There is a low clearance of primary conductor to structure, secondary 1/0 lash conductor to structure and telephone conductor to structure at this location. Mr. Ed Gregory's Garage, Hwy. 15, Lost Creek, Kentucky. Kentucky Power's single phase and lash secondary lines are in violation of 807 KAR 5:041, Section 3(1) 1981 NESC Edition Table 234-1 (Vertical). (See line clearances of this report) General Telephone's phone cable is in violation of KAR 5:061, Section 2(1) 1981 Edition Table 234-1 (Vertical) (See Line Clearances of this report.)

RECOMMENDATIONS It is recommended that Kentucky Power and General
Telephone Company take corrective action to correct these clearances
and furnish documentation as to corrective action taken. It is also
recommended that the Commission consider action in accordance with
KRS 278.990 due to line clearance violations by Kentucky Power and
General Telephone required by 807 KAR 5:041, Section 3(1) and 807
KAR 5:061, Section 2(1); NESC Table 234-1 (Vertical).
CORRECTIVE ACTION Corrective action has been taken to correct this
low clearance and documentation will be furnished by this utility
upon receipt of this report.

LINE CLEARANCES

		As Keasured	Minimum Allowed by NESC 1981 Edition	
A.	AT POINT OF ACCIDENT		Lyon Marchaell	
	Phase conductor to ground elevation:	31'-2"	20'-0"	
	Neutral conductor to ground elevation:	25'-5"	18'-0"	
	Lash Secondaries to ground:	25'-5"	18'-0"	
	Communication conductor to ground elevation:	23:-1"	18'-0"	
	Phase conductor to structure:	5'-5 1/2	10'-0"	
	Neutral conductor to structure:	0 ' -0"	3'-0"	
	Lash Secondaries to structure:	0'-0"	3'-0"	
	Communication conductor to structure:	0 * - 0 "	3'-0"	
В.	AT LOWEST POINT OF SPAN			
	Phase conductor to ground elevation:	31 ' -2"	20'-0"	
	Neutral conductor to ground elevation:	25'-5"	18'-0"	
	Communication conductor to ground elevation:	23'-1"	18'-0"	
C. SPAN LENGTH 247'				
Dat	e the line or facilities were con	nstructed: Decer	nber, 1985	
Oti	Utility: Kentucky Power - Hazard Division			
Date: 7/21/89 Time 12:00 P.M.				
App	proximate temperature: 88 Degree	es F		
Mea	surements made by: R.J. Everso	le Engineer-Paul	Pratt Serviceman	
01	Kentucky Power - Hazard Division	n and witnessed	oy John W. Land	
<u>of</u>	the Commission Engineering staff	<u>E.</u>		
		Submitted by:	John Land	
	Page (4 of 4	V	

ACCIDENT AND TROUBLE REPORT FORM

TODAY'S DATE	TIME 8:50PM
COMPANY Ky POWEY - HAZA	rd Division
PERSON REPORTING INCIDENT: NAME:	
	SAFETY AND HEAlth 179 r.
Address:	shland, Xy
Phone no:	06-327-/27/
ACCIDENT DESCRIPTION: C. B. Anto	CNNA CONTact 7200 Volt Single
Phase Overhead line	
THISE ONEVIEWS ITAK	
VICTIMS NAMES: John MINKE	sex_M_ age deathinjury_M
	sex age deathinjury
	sex age deathinjury
LOCATION OF ACCIDENT: Ed. Gree	
Paris Comment of the	Il was the work of the account
NEPATY GAVAGE LOST CREEK N. J. A	n Hwy 15- WEST OF HAZAVOL
TIME OF OCCURRENCE: Call taken	4+5:05 P.M. 7/20/89
	3/ /-
TROUBLE DESCRIPTION: Single P	hase 740 out
TIME OF OCCURRENCE: 4:50 PM	
TIME OF RESUMPTION OF NORMAL SERV	
NUMBER OF CUSTOMERS AFFECTED: (2	I WO EACH
	SIGNED Latinu
	DATE

1701 Central Avenue P. O. Box 1428 Ashland, KY 41105-1428 608-327-1111



RECEIVED

Claude G. Rhorer, Jr., Director Division of Engineering and Services Public Service Commission 730 Schenkel Lane PO Box 615 Frankfort, KY 40602 Tu / 26,7989

DIVISION OF UTILITY

THIS & SERVICES

July 24, 1989

Dear Mr. Rhorer:

Attached is the Summary Written Report for a public contact accident which occurred in Kentucky Power Company's Hazard Division. This accident happened July 20, 1989 and resulted in non-fatal burns to Mr. Johnny Minks of Viper, Kentucky.

Supplemental information as requested by Mr. John Land will be provided as quickly as it becomes available. Any questions should be directed to me at 606/327-1271.

Sincerely,

Salety and Health Manager

c Attachment

DESTRUCKY FORMS


PRINC ACCIDENT MOTICS


FRINKS WIFES


(1)	The state of the s	ja.
-	Johnny Kinks	Phone e
jured		Name
	Rt. 43D, Vipez, Rentucky 41774	ma, 606-439-4036
		aged by
753	Sales a Installation of Redio Recommend	t self
(2) place	Deto & Time of Loca or Applicat. Loca 7-20-69 5:00 ME THE C	, 15 and Lost Oreak, Eu. Sauard
(3)	Mature & Butant of Injury	
	2nd degree facial barne; 3rd degree 14	g burgs
jury		
	There was injured token after earthest	lime of Botter
	Middle Ty. Miver Mospital, Jackson, Ke	atuoky
4)	Ower	Phone:
-		
aty	Adiroso	me.
*	7/18 Press	intimated cost
<u> </u>		There;
	Tin Mullins	Manus 606-476-213
1006 1	Address	The second secon
	Accup Creek	Thomas and the same of the sam
amt to	Adresa	
in11		
		Phone:
w of	Address	
·	Seminal Principal Control of the Con	
5	the eccurrence including date, hodge H	sterested vituaeess the harr mything short o, or name of polica authority to them the
•	Mr. Minks and Mr. Mallins were insta	ling a CT antenna on top of a building.
ption		t of the enterne made operant with an
ant	energized 7200 volt line.	
	It is important that my article, part	or sypliance occolog the occurrence be
	earofully preserved. Actor shotels if	
	Mate	
	7-24-89	"GQ W LOOM

PSC Field Sketch

41

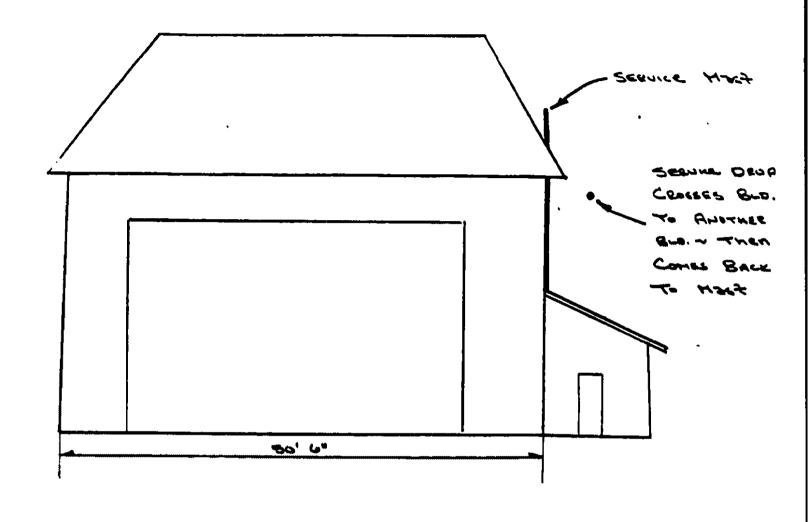

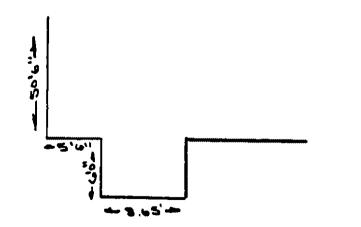

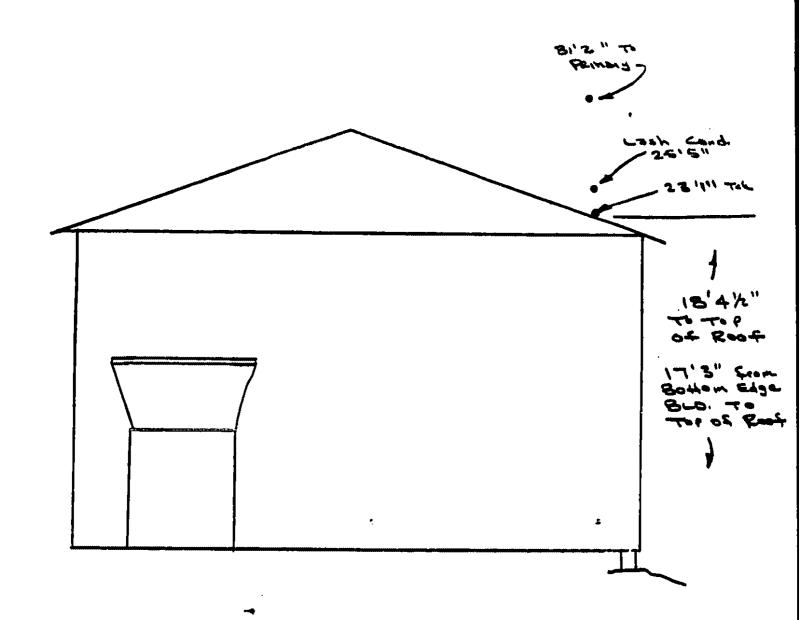

, to

Kentucky Power Company 608 High Street P. 0. 80x 958 Hazard, KY 41701-0958 606-436-1212



RECEIVED

AUG 0 8 1989

DIVISION OF UTILITY ENGINEERING & SERVICES

Public Service Commission 730 Schenkel Lane Box 615 Frankfort, Kentucky 40602

August 7, 1989

Attn: John Land

Subject: Johnny Minks 7-20-89

Dear John:

Per your request, the system inspection was performed on the accident site on March 27, 1989.

The inspection is completed by using a distribution map and checking off each pole and the equipment on it. When the technician completes the inspection, any system deficiencies are posted to our inspection inventory sheet. Jobs would then be issued to correct any problem. The inventory inspection sheet is maintained chronologically.

Attached is the inspection inventory sheet for the March 27, 1989 period. You will note that no work was released at that time.

Additionally, you requested the EMT report. Mr. Ron Montgomery with Crawford and Company is in the process of obtaining this report.

Feel free to contact me if you require additional information.

Very truly yours,

P. R. Williamson

Human Resources Supervisor

PRHICE

Attachment

CC: Wayne B. Edwards W/A

INSPECTION - INVENTORY

		,				— (1)
2-10-89	W. O. NUMBER	DESCRIPTION 764-28	JOB PLANNER		action Hours Town	COMPLETIC
	000-5546	BEPLACE BAD POLE	E.M.	2-23-89	Regenera	MIE
2-10-89	870410010	REPLACE GUY, 487-81	6M.	2-23-89	400	3-55- 6
2-10-89	899410007	859-6 559-14 REMALE BAD POLES	EM.	2-23-89	Replaned	· ·
-2-89	890610009	Removes service	280		Rannuag	3-14-6
-2-89	990-5560 990600002	2210-19 4 21		3-2-89	340.0	3-8-8.
·2-89	890600008	Femore x 5mm	ww	3-8-89	Pous Panned Yearns	4-10 4
-2-49	89060 0004	Rambre x cm + Tap	ww	3-8-89	Removed	A-10-4
-2-87	670600000	General & Com.	ww	3-8-89	Campred X	3-16-8
-7 - 69	040-2119 598650012-	Re-227-182	w w	3-13-89	Grading & STE	
-7-89	290650014	251-62	w w	3-13-89	P 74:32	3.22.6
-3-89	891230019	Replay - 32 - my	EM.			
-3-89	89 123 0018	Pepunca -7507	EM			
-3-89	89 123 00 17	Retire 200, +604 461-30	EH			
-3 - 89	891230021	Replace Bad Pole 4377	EM			
-3-89	2500 121 6035	19 317 31, 32	Je.			
-3-89	89 121 0034	Remove Lune + 12- 40,24,23	J.E.			
-17-89	050- 2375	Remove Kinh.	J.R.			<u></u>
-17-89	050- 27674	483-99 & 147.	١٩٠٤			
-6-89	890950029 650-2379	Comore pole port	75			***************************************
					<u> </u>	
			- بر دنیا ^۱ استورین است _{در جیا} استورین			
			· · · · · · · · · · · · · · · · · · ·			
						gagannakhigunakannganadar-ak e-
						140-440-114-00-114-00-114-114-114-114-11

Kentucky Power Company 608 High Street P. O. Box 958 Hezerd, KY 41701-0958 606-436-1212

RECEIVED

ATE FEMILIERY

AUG 0 1 1989

DIVISION OF UTILITY ENGINEERING & SERVICES

Mr. John Land Public Service Commission 730 Schenkel Lane P. O. Box 615 Prankfort, Kentucky 40602

Re: Johnny Minks Accident 7-20-89

July 31, 1989

Dear Mr. Land:

Per your request, I have enclosed copies of the drawings of the building Hr. Minks was working on, the antenna he was installing, distribution map 102 with the system inspection date of March 27, 1989 in the upper lefthand corner and right~of~way map 102.

Mr. Ron Montgomery, with Crawford and Company, has been requested to obtain a copy of the EMT report. In addition, Mr. Montgomery is attempting to find out the details of when the building was erected. This information will be provided as soon as it is obtained.

If you have additional questions, feel free to call on me.


Yours very truly,

P. R. Williamson


Human Resources Supervisor

Enclosures

cc: W. B. Edwards - w/o enclosures

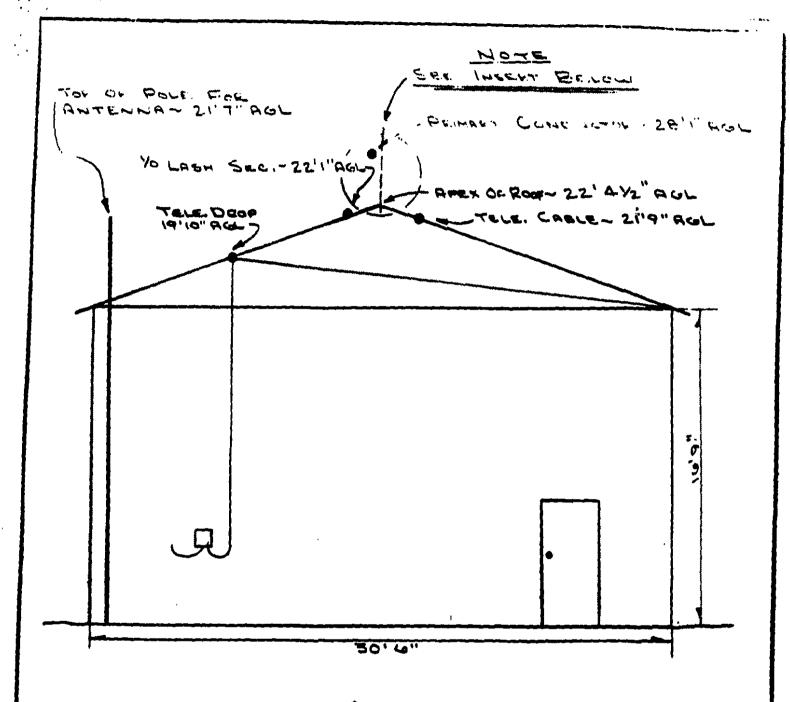

MOTE: AGLE AGOVE GROUND LEVEL

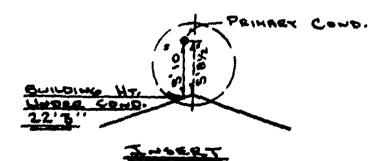

BUNVEYED BY BUNG STANKE , CO.C.

KENTUCKY POWER COMPANY ENGINEEZHIG SEPARTMENT HAZARD RESTUGIS	
JOHHHY	MINKS
Accident UED,	0~ 7-20-89 ky.
LENGTH	W.O. OR L.O.
a.w public	W. 9, NO,
AM PRIVATE	LINE NO.
8.9.W.	DISTRICT
BEAUN BY CO. C.	TYPE LINE
Seve Mond	TAK BIST.
BATE TO THE PARTY OF THE PARTY	

THE PROPERTY.

SERVICE MAST.

SERVICE DEST.

SHOW, GCEOSS

ROAD.


SO'U"

SO'U"

Seavice Drop to This Building Cones Back From The Seavice Shown About.

KENTUCKY POWER COMPANY BROWNEEDING DEPARTMENT HAZARD HENTUCKY		
JOHHNY ACCIDENT NEO,	MINKS 90 7-20-89	
LENGTH	M.C. OR L.O.	
AW PUBLIS	W. 9. 110.	
RW PRIVATE	LINE NO.	
9. O.W.	PIETRIET	
BRAWN BY CE. C.	TYPE LINE	
MAR WORK	TAR BUTT	
BATE 3-24-57	MAR MO.	

SURVEYED BY T.W. G. L. G.C.

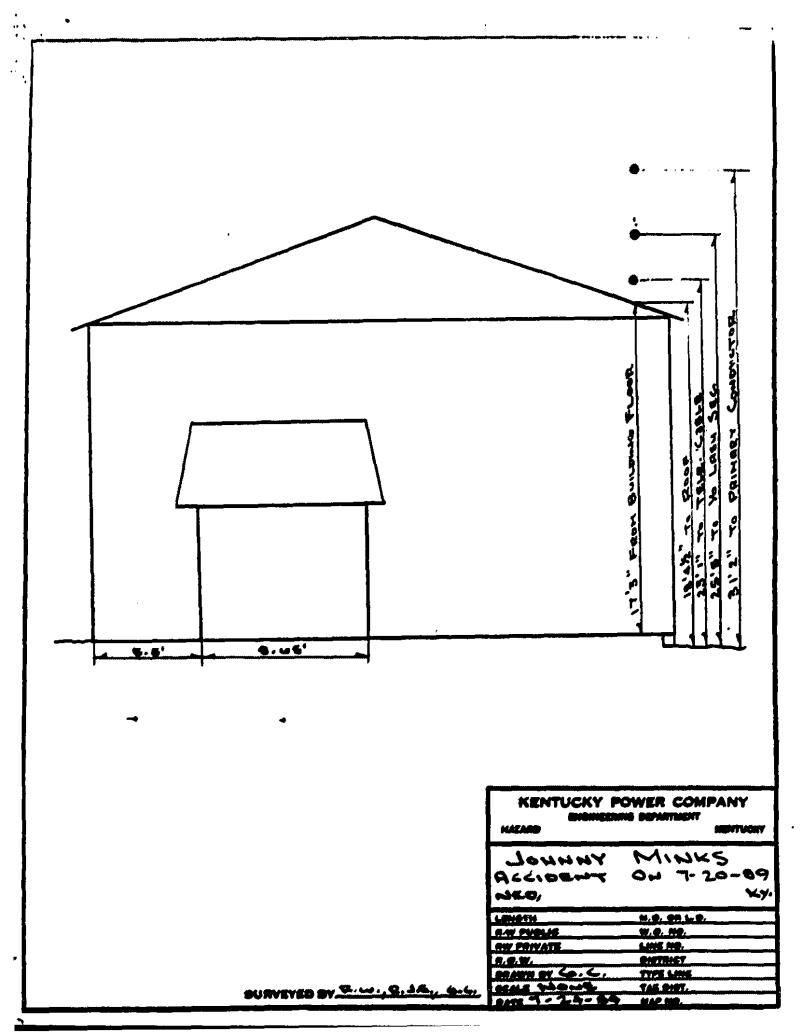



KENTUCKY POWER COMPANY ENGINEERING SEPARTMENT HAZAND KENTUCKY		
LOHUNY	MINKS	
ACCIDENT	On 7-20-89	
NED	Ky.	
LENGTH	M.O. OR L. G.	
R-W PUBLIC	W. Q. HQ.	
AM PRIVATE	LINE NO.	
9 W.	DISTRICT	
BRAWN BY CO.C.	TYPE LINE	
BENE MONE	TAN DIST.	
Part 4-1-5-64	3/42 3/8.	


SURVEYED BY A.W., P. JE, C. C.

KENTUCKY POWER COMPANY SHOMESHING DEPARTMENT KENTUCKY		
YunnoL	MINKS	
RCCIDENT	ON 7-20-69	
JED,	KY.	
LENGTH	M.C. OR L.C.	
RAY PUBLIC	W.O. 110.	
RW PRIVATE	LINE NO.	
8. O.W.	PIETRICT	
GRANN BY CO. C.	TYPE LINE	
SENE MONE	TAS DIST.	
PATE 7-24-89		

SURVEYED BY Q. W. Q. LAB., M.C.

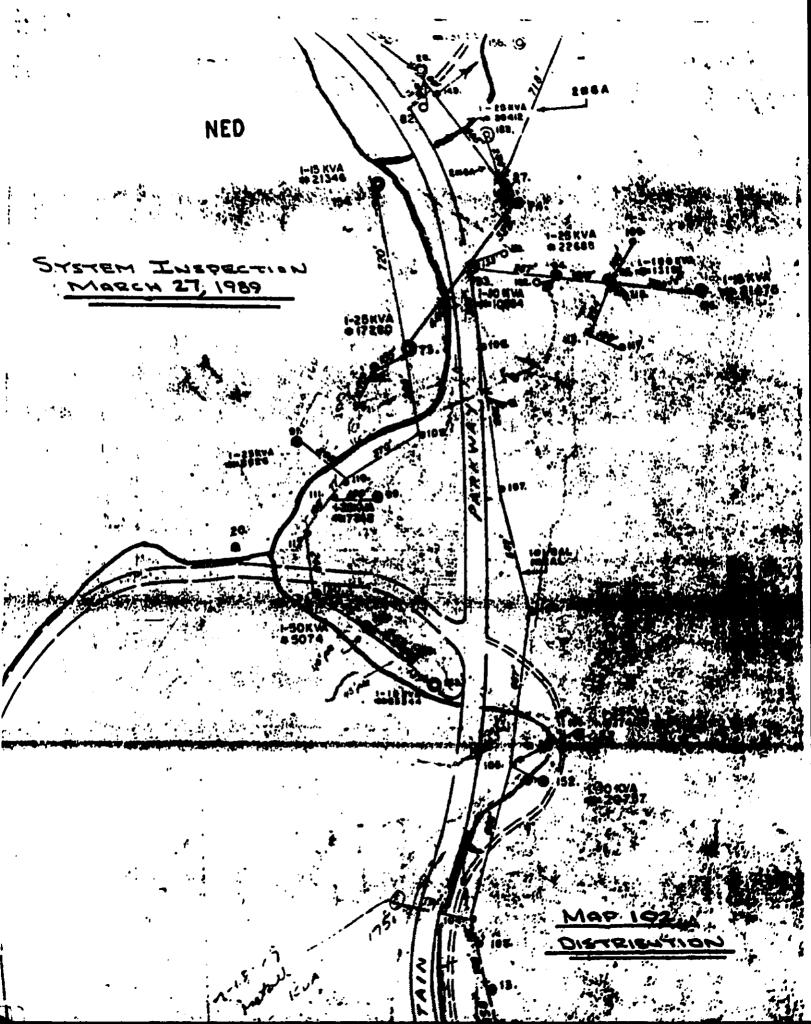

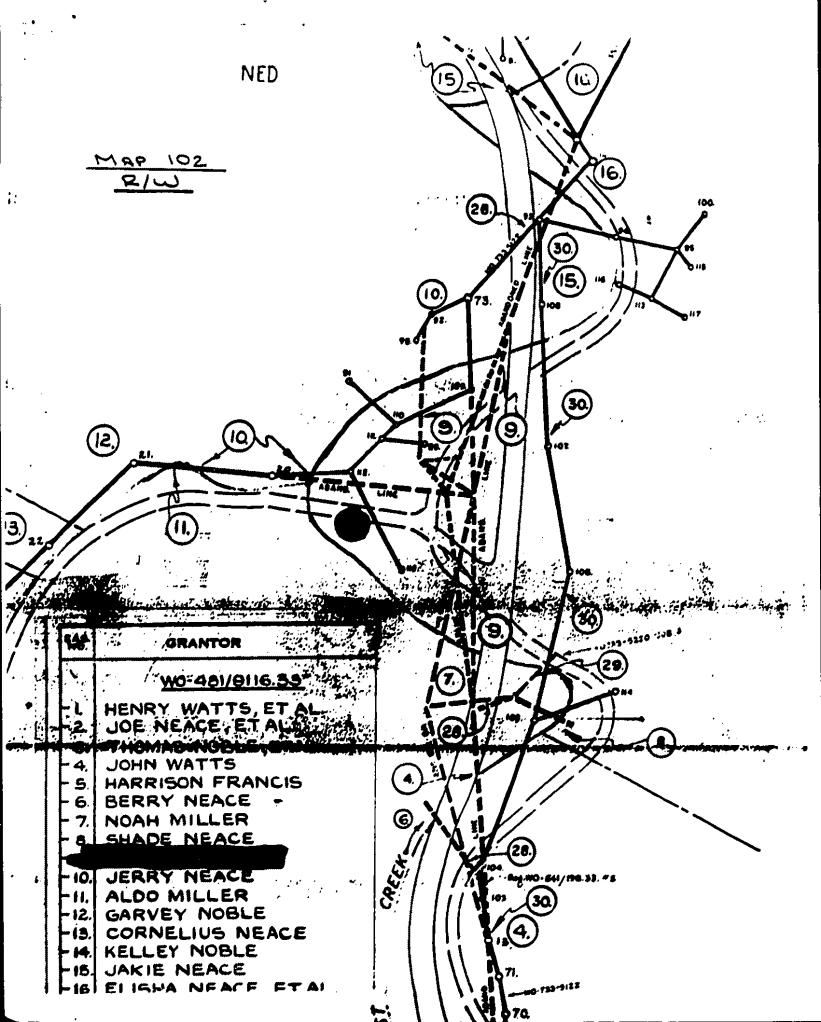


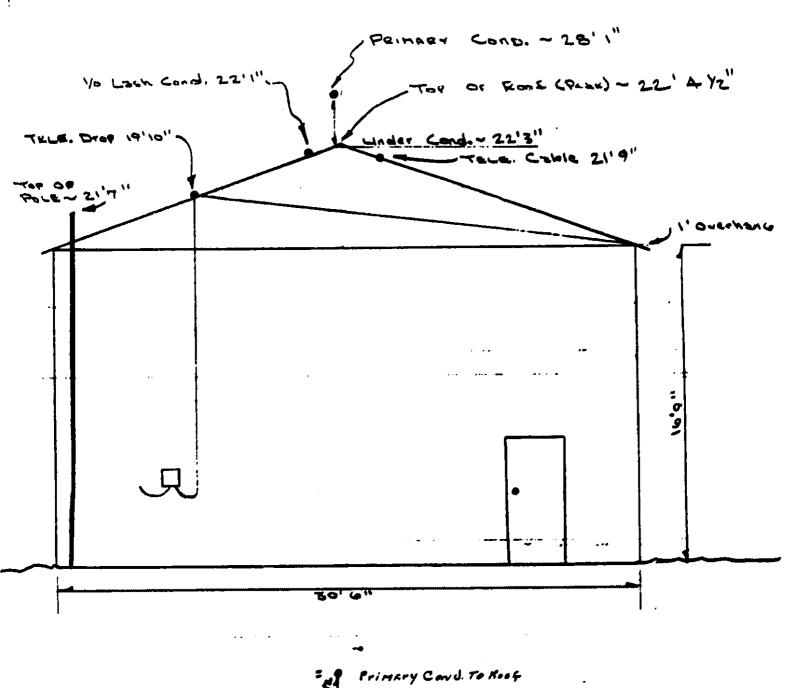


Primary Coul. To Koof

PSC Field Sketch

-

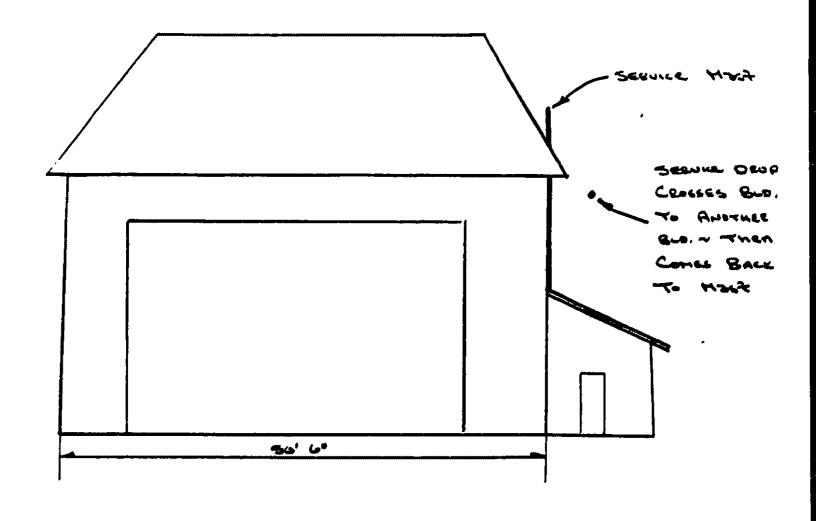

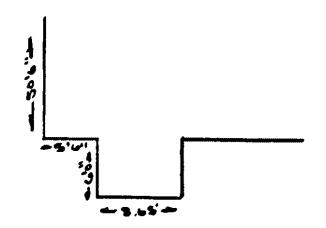

B1'2" TO PRIMENS > 12615" 28 1911 Tak 18'4%" TO TOP OF ROOF 17'3" from Bottom Edge BLD. To Top Of Roof

X