

5-Service  
M-Main

MARTIN CONTRACTING, INC.  
LEAK SURVEY

Tompkinsville 2012

ADDRESS	DATE	CLASS			SIZE	LEAK DESCRIPTION	TYPE OF LINE	
		A	B	C			STEEL	PE
Intersection of 44th St. & Magnolia	10-16			✓	2"-M	Leak detected in ground on valve	✓	
104 N. Magnolia	10-16			✓	2"-M	Leak detected in ground on main at the side of the building on Ky. Ave.	✓	
415 Crawford St.	10-16			✓	3/4"-S	Inlet side bottom of lock valve.	✓	
Monroe Co. Jail 202 Crawford to Tompkinsville Drug	10-16	✓			2"-M	Inlet side on lock valve & regulator. Leak detected in ground in front of home & extends to Tompkinsville drug. Gas present inside business. Immediate action has been taken. CGI 100% outdoors in bar holes.	✓	
~~~~~								
125 Crawford St.	10-16			✓	3/4"-S	Inlet side on lock valve	✓	
Tamie Hayes "No Address" Crawford St.	10-16			✓	3/4"-S	Inlet side on lock valve and on the coupling just above the lock valve.	✓	
104 Magnolia St.	10-16			✓	2"-M	Leak detected in ground appx. 6-8 ft directly in front of the meter located on Mc Cawley St.	✓	
~~~~~								
Tompkinsville Police Dept.	10-16			✓	3/4"-S	Leak detected in ground at patch of blacktop in the parking lot just left of the steps at road edge.	✓	
~~~~~								
2nd St. "Pro Pl. H Realty"	10-17	✓				Leak detected in ground in front of business & extends to intersection of 2nd St. and Magnolia. Gas is present inside the business. Immediate action taken.	✓	
~~~~~								
206 S. Magnolia No address.	10-17			✓	3/4"-S	Leak detected in ground at base of riser, possibly on the dresser coupling.	✓	
5. Magnolia "IMC Group"	10-17			✓	3/4"-S	Inlet side top of lock valve.	✓	
301 S. Magnolia	10-17			✓	3/4"-S	Inlet side on lock valve <del>at base of riser.</del>	✓	

S-Service

M-Main

MARTIN CONTRACTING, INC.  
LEAK SURVEY

Tompkinsville 2012

ADDRESS	DATE	CLASS			SIZE	LEAK DESCRIPTION	TYPE OF LINE	
		A	B	C			STEEL	PE
303 S Magnolia	10-17			✓	3/4"-5	In ground at base of meter.		✓
303 1/2 S. Magnolia	10-17		✓		3/4"-5	Inlet side lock valve leaking through. Meter is no longer there.		✓
Strodes Trailer Park S. Magnolia	10-17		✓		3/4"-5	Regulator broke on farm tap next to main highway.		✓
333 S. Magnolia	10-17			✓	1/4"-M	Leak detected in ground appx. 60 ft. South of drive way		✓
No Address Camalia Rd. "Ricky Johnson"	10-17		✓		3/4"-5	Inlet side on lock valve and regulator. Nisor need replaced. Steel is pitted bad.		✓
Falcons Nest store Camalia Rd.	10-17		✓		1/2"-5	Leak found on 1/2" PE line on customer side. Has been patched with a piece of hose and a clamp.		✓
429 South Main	10-17			✓	2"-M	Leak detected in ground just up hill from mail box.		✓
Save-A-lot S. Main	10-17		✓		3/4"-5	Inlet side on lock valve.		✓
Tropical Tan & Gifts S. Main	10-17		✓		2"-M	Leak detected in ground appx. 40 ft South of drive toward Save-A-lot.		✓
212 S. Main	10-17			✓	3/4"-5	Inlet side on repair clamp		✓
210 S. Main	10-17			✓	3/4"-5	Inlet side on lock valve		✓
208 S. Main	10-17		✓		3/4"-5	Hole in Nisor.		✓
206 S. Main	10-17			✓	3/4"-5	Inlet side on lock valve		✓
William B. Harlan Library 4th St.	10-22			✓	3/4"-5	Inlet side on bottom of 1st 90°		✓
Monroe Co. Board of Edu. 4th St.	10-22			✓	2"-5	Inlet side on bottom of regulator and top set screw of regulator. Leak also on on outlet side on small secondary regulator.		✓
513 West 4th St.	10-22				3/4"-5	Inlet side bottom of union + bottom of 90°		✓
403 4th St. Blvd.	10-22			✓	3/4"-5	Leak detected in ground at base of meter.		✓
Century's Service Center 4th St. Blvd.	10-22			✓	3/4"-5	Leak detected in ground by water meter at corner of the building.		✓

5-Service  
M-Main  
MARTIN CONTRACTING, INC.  
LEAK SURVEY

Jason Lawrence

Tompkinsville 2012

ADDRESS	DATE	CLASS			SIZE	LEAK DESCRIPTION	TYPE OF LINE	
		A	B	C			STEEL	PE
609 4th St. Blvd	10-22		✓		3/4" - S	Inlet side on compression coupling and bottom of lock valve. Leak is <del>beginning</del> beginning to migrate into the ground around the service.	✓	
<del>403</del> 501 5th St.	10-22			✓	3/4" - S	In ground at base of riser Leak detected in ground under concrete pad located on 5th. St. side of home appx. 20' out from gas meter. Leak also on inlet side on bottom of lock valve.	✓	
409 Lake St.	10-22			✓	3/4" - S	Leak detected in ground approx. 55' south of blacktop drive at road edge.	✓	
409 Lake St. "Gazebo"	10-22			✓	2" - M	Inlet side on lock valve.	✓	
403 Lake St.	10-22			✓	3/4" - S	Lock valve leaking through. Meter pulled.	✓	
307 Patricia Ave.	10-22			✓	3/4" - S	Leak detected in ground possibly on the service tap approx. 12' toward road from water meter.	✓	
402 5th St.	10-22			✓	2" - M	In ground base of riser & also top of lock valve. Aisler is pitted & in bad condition.	✓	
409 6th St	10-22			✓	3/4" - S	Inlet side bottom of lock valve	✓	
415 6th. St.	10-22			✓	3/4" - S	Inlet side bottom of lock valve.	✓	
504 6th St.	10-22			✓	3/4" - S	Inlet side on compression fitting on riser also the inlet side on top of lock valve.	✓	
617 Emberton St.	10-22			✓	3/4" - S	Outlet side of Meter spud.	✓	
221 7th St. "Veachel Harlan"	10-22			✓	2" - M	Leak detected in ground approx 10ft south of gravel drive in ditch line.	✓	
Scott Hale 7th St.	10-22		✓		2" - S	Leak detected in ground on 2" riser near large vents.		✓
Monroe Co. High School	10-22							